

# ***Antifreeze Solutions in Home Fire Sprinkler Systems***

## ***Phase II Research Interim Report***

**Prepared by:  
Code Consultants, Inc.**



**THE  
FIRE PROTECTION  
RESEARCH FOUNDATION**  
*Research in support of the NFPA mission*

**FIRE RESEARCH**

The Fire Protection Research Foundation  
One Batterymarch Park  
Quincy, MA, USA 02169-7471  
Email: [foundation@nfpa.org](mailto:foundation@nfpa.org)  
<http://www.nfpa.org/foundation>

© Copyright Fire Protection Research Foundation  
August 2010

## FOREWORD

NFPA 13, *Standard for the Installation of Sprinkler Systems*, has included guidance on the use of antifreeze solutions in fire sprinkler systems since the 1940 edition. Recent fire incidents, analysis of available literature, and preliminary testing have identified concerns with the use of certain antifreeze solutions. Under certain conditions, solutions of glycerin and propylene glycol antifreeze have been found to ignite when discharged from automatic sprinkler systems. A literature review, preliminary testing, and a long term research plan were developed as part of Phase I of this project. This Interim Report has been prepared to outline the results of Phase II of the project, which includes further testing of propylene glycol and glycerin antifreeze solutions for a range of concentrations and operating conditions.

The content, opinions and conclusions contained in this report are solely those of the author.



**THE  
FIRE PROTECTION  
RESEARCH FOUNDATION**  
*Research in support of the NFPA mission*

**Project Technical Panel**

**Home Fire Sprinklers and Antifreeze Solutions**

**Phase II**

Magnus Arvidson  
Elizabeth Buc  
Scott Futrell  
Tonya Hoover  
Garner Palenske  
Maurice Pilette  
Noah Ryder  
Joe Senecal  
Pete Willse  
Jim Lake

Swedish Testing and Research Center  
Fire and Materials LLC  
Futrell Fire Design and Consult  
CAL FIRE – Office of the State Fire Marshal  
Schirmer Engineering  
Mechanical Designs Inc (chair of NFPA 13D)  
Packer Engineering  
Kidde Fenwal  
XL Insurance  
NFPA Staff Liaison

**Contractors**

Steve Wolin  
Kerry Bell

Code Consultants, Inc.  
Underwriters Laboratories Inc.

**Sponsor Representatives**

Chris Dubay  
James Golinveaux  
Scott Franson  
Russ Fleming  
Roland Huggins  
Tom Multer  
Tom Wancho and Ken Swantek

NFPA  
Tyco Fire Suppression and Building Products  
The Viking Corporation  
NFSA  
AFSA  
Reliable Automatic Fire Sprinkler Co.  
Victaulic



THE  
FIRE PROTECTION  
RESEARCH FOUNDATION  
*Research in support of the NFPA mission*

**Home Fire Sprinklers and Antifreeze Solutions  
Phase II**

**Project Sponsors**

National Fire Protection Association  
American Fire Sprinkler Association  
National Fire Sprinkler Association  
Tyco Fire Suppression and Building Products  
Victaulic  
The Viking Corporation

**Contributing Sponsor**

Reliable Automatic Fire Sprinkler Co.

***Interim Report***  
**Phase II Research**  
**Antifreeze Solutions in Home Fire Sprinkler Systems**

Prepared for:

The Fire Protection Research Foundation  
1 Batterymarch Park  
Quincy, MA 02169

Prepared by:

**CODE CONSULTANTS, INC.**  
1804 Borman Circle Drive  
Saint Louis, MO 63146

CCI Project No. 100138.04.001

August 11, 2010

© 2010 Fire Protection Research Foundation



## Table of Contents

	Page
<b>Executive Summary</b> .....	<b>1</b>
<b>I. Introduction</b> .....	<b>3</b>
<b>II. Background</b> .....	<b>5</b>
A. Antifreeze Solutions .....	5
B. Flammability of Liquids .....	8
C. Sprinkler Droplet Sizes and Distributions .....	12
D. Phase I Testing .....	14
<b>III. Phase II Test Plan and Setup</b> .....	<b>16</b>
A. Scope A: Room Fire Tests for Spray Ignition using Sprinklers.....	16
B. Scope B: Room Fire Tests for Sprinkler Effectiveness.....	21
<b>IV. Phase II Test Results</b> .....	<b>25</b>
A. Scope A – Spray Ignition .....	25
B. Scope B – Room Fire Tests .....	34
<b>V. Summary</b> .....	<b>41</b>
<b>VI. References</b> .....	<b>42</b>
<b>Appendix A – Phase II Test Matrix</b>	



## Executive Summary

NFPA 13, *Standard for the Installation of Sprinkler Systems*, has included guidance on the use of antifreeze solutions in fire sprinkler systems since the 1940 edition. [1] Antifreeze solutions may be used in fire sprinkler systems where the piping system, or portions of the piping system, may be subject to freezing temperatures. [2] Antifreeze solutions permitted for use in sprinkler systems connected to potable water supplies include propylene glycol and glycerin.

Recent fire incidents, analysis of available literature, and preliminary testing have identified concerns with the use of certain antifreeze solutions. Under certain conditions, solutions of glycerin and propylene glycol antifreeze have been found to ignite when discharged from automatic sprinkler systems. A literature review, preliminary testing, and a long term research plan were developed as part of Phase I of this project. This Interim Report has been prepared to outline the results of Phase II of the project, which includes further testing of propylene glycol and glycerin antifreeze solutions for a range of concentrations and operating conditions.

A test plan was developed for Phase II to investigate the potential for large-scale ignition of antifreeze solutions discharged from residential sprinklers and the influence of antifreeze solutions on the effectiveness of residential sprinkler systems in controlling a fire condition and maintaining tenable conditions for egress. Testing was conducted in two parts. Scope A consisted of fire tests using six (6) models of sprinklers at elevations of 8 ft and 20 ft to investigate the potential for large-scale ignition of antifreeze sprays at pressures ranging from 10 psi to 150 psi. Scope B consisted of room fire tests, similar to UL 1626, that were designed to investigate the effective of sprinklers discharging antifreeze solutions and their ability to maintain tenable conditions.

Results of the Scope A testing indicate that concentrations of propylene glycol exceeding 40% by volume and concentrations of glycerin exceeding 50% by volume have the potential to ignite when discharged through automatic sprinklers. The potential for ignition depends on several factors including the ignition source, sprinkler model, sprinkler elevation, and discharge pressure. Ignition of antifreeze spray increased the measured heat release rate in certain tests with 50% propylene glycol and 55% glycerin by more than 300%. For certain test conditions, the increase in heat release rate resulting from the application of 55% glycerin solution exceeded the increase in heat release rate from the application of 50% glycerin solution by a factor of 10. A similar level of sensitivity was observed between 40% and 50% propylene glycol solutions, but not between 40% and 45% propylene glycol solutions.

The results of the Scope B testing indicated that concentrations of propylene glycol not exceeding 40% by volume and concentrations of glycerin not exceeding 50% by volume have similar performance to water as compared to the UL 1626 fire control criteria. Both the 40%



propylene glycol and 50% glycerin solutions met the UL 1626 fire control criteria and demonstrated similar performance to that of water alone throughout the series of tests.

The results of this research suggest that antifreeze solutions of propylene glycol exceeding 40% and glycerin exceeding 50% by volume are not appropriate for use in home fire sprinkler systems. Consideration should be given to an appropriate safety factor for concentrations of these antifreeze solutions that are permitted by future editions of NFPA 13. In addition, based on the flammability properties outlined in Table 4, the use of solutions of diethylene glycol and ethylene glycol in home fire sprinkler systems should also be limited unless testing is conducted to establish that they are appropriate for use in home fire sprinkler systems.



## I. Introduction

Recent fire incidents raised questions regarding the effectiveness of antifreeze sprinkler systems in controlling residential fire conditions. As a result, the Fire Protection Research Foundation retained Code Consultants, Inc. (CCI) to perform a literature search and develop a research plan to investigate the impact of antifreeze solutions on the effectiveness of home fire sprinkler systems [3]. The literature review included the following subjects:

1. Antifreeze sprinkler system requirements
2. Mixing and separation of antifreeze compounds commonly used in sprinkler systems
3. Flammability of antifreeze solutions commonly used in sprinkler systems
4. Factors influencing the flammability of liquids, such as dispersion in droplets
5. Characterization of residential sprinkler sprays
6. Factors influencing the potential for flash fires or explosions from liquid sprays
7. Existing fire test data on the effectiveness of antifreeze solutions at controlling fire conditions
8. Fire incident reports involving antifreeze sprinkler systems

A research plan was developed to supplement the literature review in areas where existing information was limited. In addition, CCI observed a series of preliminary fire tests (Phase I) conducted by Underwriters Laboratories, Inc. (UL) to investigate the effectiveness of antifreeze sprinkler systems in controlling certain home fire scenarios. A summary of data from the preliminary testing was also provided by UL. [4] CCI provided suggestions for further research to provide a more complete analysis of currently permitted antifreeze solutions as well as to investigate other antifreeze solutions that could be used in sprinkler systems.

The Phase I testing identified the need for additional research regarding the potential for antifreeze solutions to create a large-scale ignition of spray when discharged through automatic sprinklers onto a fire. Additional research was also needed to further investigate the impact of antifreeze solutions on a sprinkler system's ability to control a fire condition and maintain tenable conditions. As such, a Phase II test plan was created based on the Phase I information.

The Phase II test plan was separated into two scopes (A and B) which were intended to investigate additional research identified in Phase I. Scope A tested antifreeze solutions for the potential to create a large-scale ignition of the spray when discharged through sprinklers onto a



fire. Scope B tested antifreeze solutions for its impact on a sprinkler system's ability to control a fire condition and maintain tenable conditions.



## II. Background

Recent fire tests have indicated the potential for ignition of certain antifreeze solutions discharged from automatic sprinkler systems.[4] The potential for ignition of an antifreeze spray and the influence of antifreeze solutions on sprinkler effectiveness involves several complex and contemporary research topics. This section provides a basic summary of relevant background information; a more complete discussion can be found in the report from Phase I of this project. [3]

### A. Antifreeze Solutions

NFPA 13 [5], 13D [6], and 13R [7] each include substantially similar requirements for antifreeze solutions used in sprinkler systems. Antifreeze solutions of propylene glycol and glycerin with water are each permitted in sprinkler systems connected to potable water supplies. The antifreeze solutions are intended to protect sprinkler piping that passes through areas that could be exposed to freezing temperatures. Freezing point data for propylene glycol and glycerin solutions provided in NFPA 13 is summarized in the following table.

Material	Solution with Water (by Volume)	Specific Gravity at 60 °F (15.6 °C)	Freezing Point	
			°F	°C
Glycerin ( C.P. or U.S.P grade)	50% glycerin	1.145	-20.9	-29.4
	60% glycerin	1.171	-47.3	-44.1
	70% glycerin	1.197	-22.2	-30.1
Propylene glycol	40% propylene glycol	1.034	-6	-21.1
	50% propylene glycol	1.041	-26	-32.2
	60% propylene glycol	1.045	-60	-51.1

C.P.: Chemically pure. U.S.P.: United States Pharmacopoeia 96.5%

Table 1: Adapted from NFPA 13 Table 7.6.2.2 Antifreeze Solution to be Used if Potable Water is Connected to Sprinklers

Antifreeze solutions of ethylene glycol and diethylene glycol are also permitted, but only in sprinkler systems that are connected to non-potable water supplies. This research focuses on propylene glycol and glycerin antifreeze solutions, because they are believed to be much more commonly used in home fire sprinkler systems.

Antifreeze solutions of glycerin, diethylene glycol, and ethylene glycol were included in NFPA 13 starting in the Appendix of the 1940 edition, known as National Board of Fire Underwriters Pamphlet No. 13 at the time. [1] The 1953 edition of NFPA 13 included requirements for



antifreeze sprinkler systems in the body of the standard and permitted the use of propylene glycol or calcium chloride solutions as well as glycerin, diethylene glycol, and ethylene glycol. [8] The antifreeze solutions and concentrations permitted by the 1953 edition of NFPA 13 are the same as those permitted by the current (2010) edition of NFPA 13, with the exception that calcium chloride is no longer permitted. [2]

Table 2 (below) illustrates the freezing point and the specific gravity values (at 25°C) for a propylene glycol-water mixture in addition to the corresponding percent volume and percent weight of propylene glycol. The difference in percent volume and percent weight of propylene glycol solutions is minimal, because its density is only slightly higher than the density of water.

<b>Propylene Glycol Properties</b>			
<b>% Vol.</b>	<b>% Wt.*</b>	<b>Freezing Point (°F)</b>	<b>Specific Gravity at 25°C</b>
0%	0%	32	1.000
5%	5%	26	1.004
10%	10%	25	1.008
15%	15%	22	1.012
20%	20%	19	1.016
25%	25%	15	1.020
30%	30%	11	1.024
35%	35%	2	1.028
40%	40%	-6	1.032
45%	45%	-18	1.035
50%	50%	-26	1.038
55%	55%	-45	1.040
60%	60%	-60	1.041

\*% Vol. to % wt. conversion is at 25°C

Table 2: Propylene Glycol Properties [9] (Portions of data are calculated or interpolated).

Similar to Table 2 (above), Table 3 (below) depicts the freezing point and specific gravity values (at 25°C) for a glycerin-water mixture in addition to the corresponding percent volume and percent weight of glycerin. Unlike the propylene glycol properties, the values for percent volume and percent weight vary significantly, because the density of glycerin is approximately 26% higher than the density of water.



<b>Glycerin Properties</b>			
<b>% Vol.</b>	<b>% Wt.*</b>	<b>Freezing Point (°F)</b>	<b>Specific Gravity at 25°C</b>
0%	0%	32	1.000
5%	6%	31	1.014
10%	12%	28	1.029
15%	18%	25	1.043
20%	24%	20	1.059
25%	29%	16	1.071
30%	35%	10	1.087
35%	40%	4	1.100
40%	45%	-2	1.114
45%	51%	-11	1.130
50%	55%	-19	1.141
55%	60%	-31	1.155
60%	65%	-46	1.168
65%	69%	-40	1.179
70%	74%	-25	1.193
75%	79%	-8	1.207
80%	83%	6	1.217
85%	87%	19	1.228
90%	92%	36	1.241
95%	96%	49	1.252
100%	100%	63	1.262

\*% Vol. to % wt. conversion is at 25°C

Table 3: Glycerin Properties [10] [11] [12] (Portions of data are calculated or interpolated)

As illustrated by the v-shaped curve in Figure 1 (below), glycerin-water solutions reach their maximum freeze protection at a concentration of approximately 60% glycerin by volume. A glycerin-water mixture that contains more than approximately 60% by volume glycerin will provide the same freeze protection as a less concentrated mixture. From a freeze protection standpoint, there is no reason to use a glycerin-water mixture that contains more than 60% glycerin by volume.

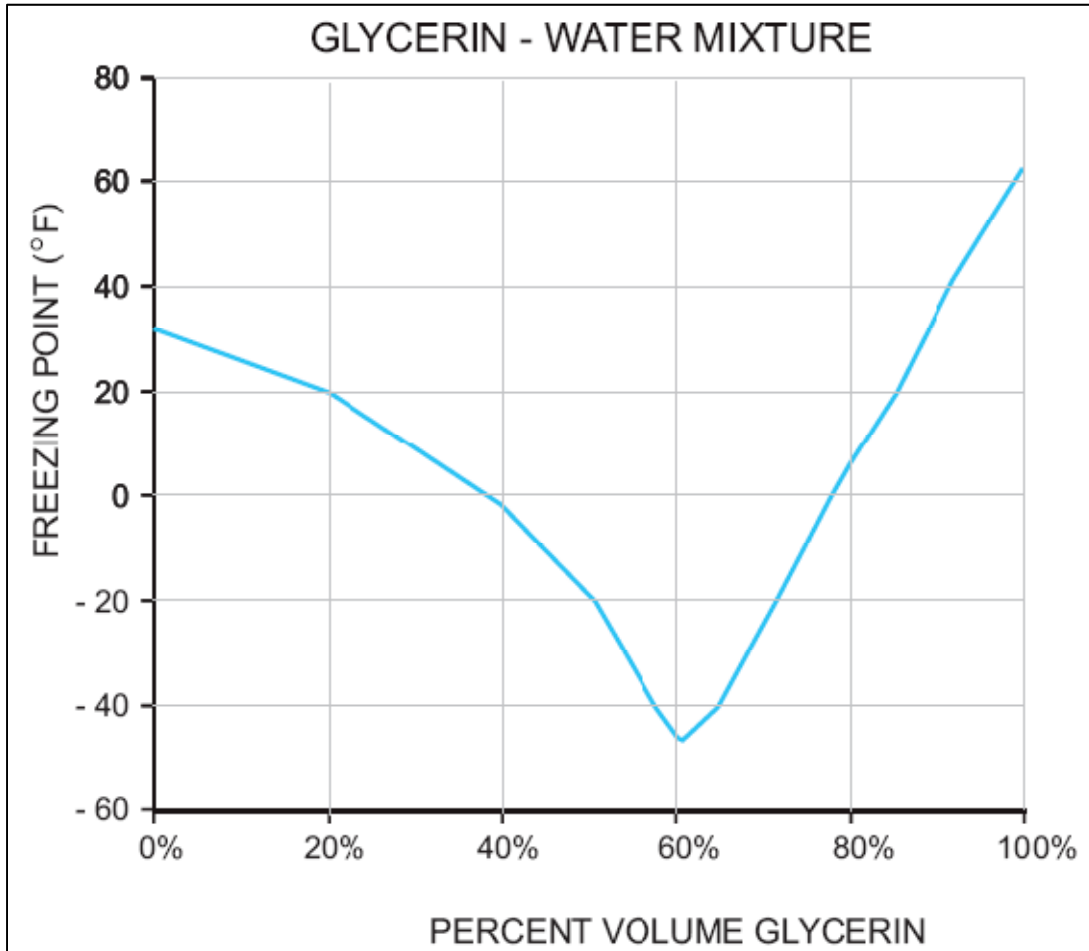


Figure 1: Freezing point of a glycerin-water mixture based on percent volume of glycerin

## B. Flammability of Liquids

Liquids have many quantifiable flammability properties that vary depending on the type of liquid and the surrounding environment. The flash point is the temperature at which a liquid must be raised in order to produce sufficient vapors for flash ignition under specified test conditions. The flash point can be measured by one of many standardized test apparatus. Figure 2, below, illustrates an example of a closed-cup tester (ASTM D 93). The tester utilizes a heated stirrer (intended to maintain temperature uniformity) inserted into the test liquid. The test liquid is heated at a rate of approximately 41°F to 43°F per minute. The tester is capable of measuring the flash point of liquids between 174°F and 750°F. [13]

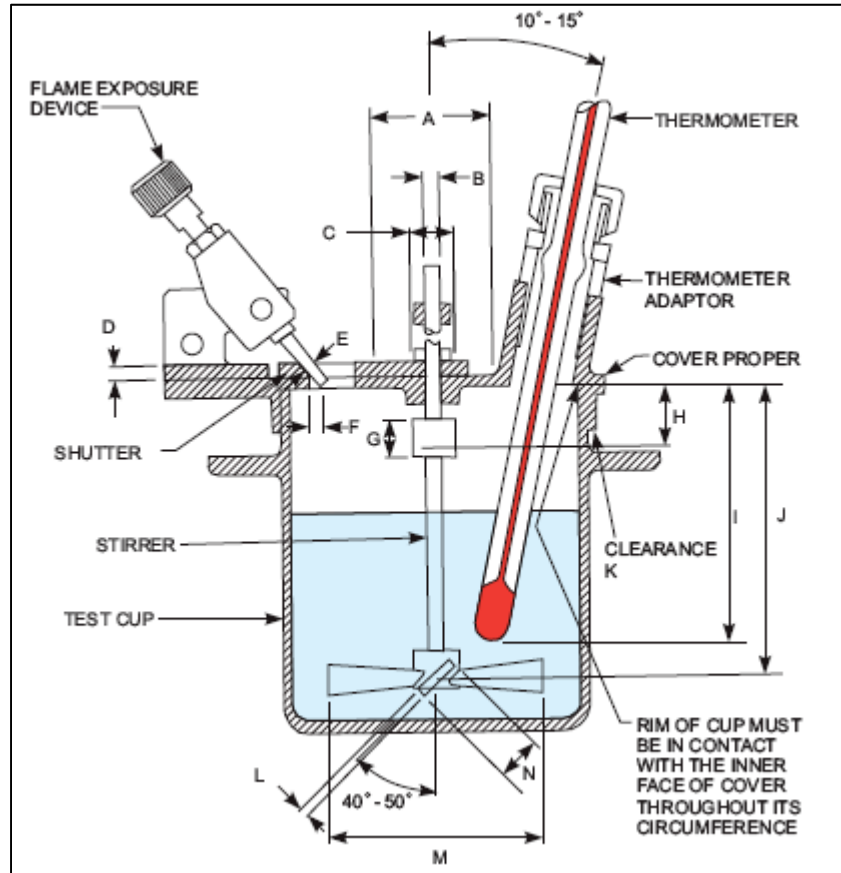


Figure 2: ASTM D 93 Pensky-Martens Closed-Cup (PMCC) Tester

Maintaining a liquid at a temperature below its measured flash point does not guarantee that ignition will be prevented. There are many factors that may influence a liquid's actual flash point. This is because the flash point of a liquid, as measured by test apparatus, is not necessarily the flash point of a liquid in its end-use environment. Liquids with flash point temperatures greater than the temperature of the environment of the liquid may sometimes be ignited by spraying, wicking or other means. Liquids that are mixtures, as opposed to pure substances, may demonstrate a tendency for vaporization of one component and not the other. The flash point of the remaining liquid may be different than that of the mixture when it was originally tested. [13]

At some temperature above a liquid's flash point temperature, an ignitable liquid's vapor can ignite without the presence of an ignition source. This is known as the autoignition temperature (AIT). There is no known relation between a liquid's flash point and its AIT. The AIT is primarily determined by a liquid's reactivity (rate of oxidation) while the flash point is determined by a liquid's volatility (rate of evaporation). Many factors may affect a liquid's AIT. Some known factors are the concentration of the vapor given off by the liquid, the shape and size of the container, the rate and duration of heating, and the test method. [13]

Figure 3 below is an example of a test method used to measure the AIT of liquids (ASTM E 659). In this method, the testing vessel is a glass flask surrounded by an electrically heated oven equipped with several thermocouples. During a test, a 0.1 mL sample of liquid is injected into the glass flask and is heated to a constant temperature while being observed for indications of ignition. Once the AIT is observed, both larger and smaller amounts of liquid are analyzed to determine the overall lowest AIT. [13]

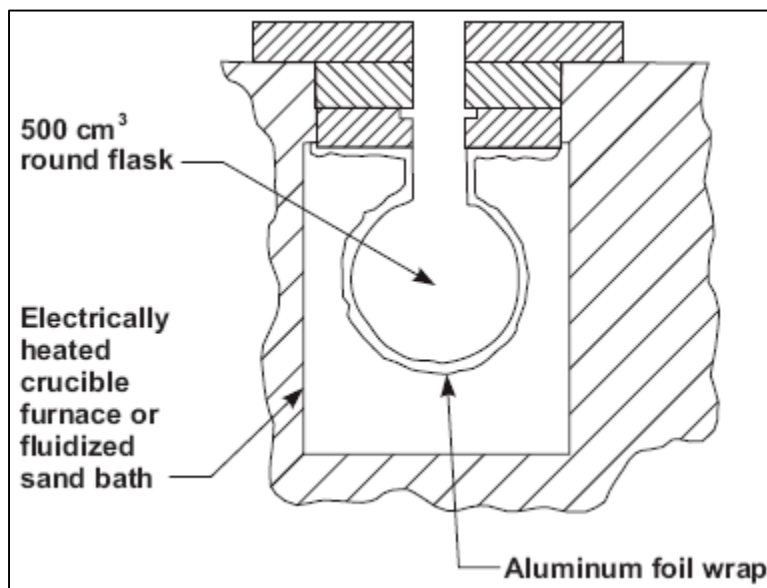


Figure 3: ASTM E 659 Autoignition Test (Setchkin Flask Test)

Flammable substances may also have an upper flammability limit (UFL) and lower flammability limit (LFL). The UFL is the highest concentration (or lowest in the case of LFL) of gas or vapor of the liquid in air capable of producing a flash fire in the presence of an ignition source.

The following table summarizes flammability properties of chemicals permitted for use in antifreeze solutions by NFPA 13.

Chemical	Flammable Limits in Air (% by volume) Lower/Upper	Flash Point (°F)	Autoignition Temperature (°F)	Boiling Point (°F)
Propylene Glycol	2.6 / 12.5	210	700	370
Glycerin	Not Provided / Not Provided	390	698	340
Diethylene Glycol	Not Provided / Not Provided	255	435	472
Ethylene Glycol	3.2 / Not Provided	232	748	387

Table 4: Flammability Properties of Pure Antifreeze Chemicals Permitted by NFPA 13 [14]

A suspension of finely divided droplets of flammable liquid in air can yield a flammable mixture that has many of the characteristics of a flammable gas/air mixture. These droplets have the



potential to burn or explode. Researchers have observed that a 10  $\mu\text{m}$  diameter droplet of flammable liquid behaves like a vapor with respect to burning velocity and LFL. Droplets with diameters larger than 40  $\mu\text{m}$  behave differently. [15]

Flame propagation can occur at average concentrations well below the LFL. A flammable mixture can also form at temperatures below the flash point of a liquid combustible when atomized into air. Testing shows that with fine mists and sprays (particles less than 10  $\mu\text{m}$ ) the combustible concentration at the lower limit is about the same as that in uniform vapor-air mixtures. However, as the droplet diameter increases, the lower limit appears to decrease. It was observed that coarse droplets tend to fall towards the flame front in an upward propagating flame, and as a result the concentration at the flame front actually approached the value found in lower limit mixtures of fine droplets and vapors. [16]

Mists made up of coarser aerosols are capable of sustaining a flame at considerably lower fuel-air ratios than fine aerosols (vapors). The reason for this lies in the ability of the droplets to move in relation to the ambient air. Mists made up of coarser aerosols prove to be more responsive to acceleration and random movement than that of finer aerosols. As such, coarser aerosols communicate flame more readily. [15]

In the case of water-glycols, flash points will not exist until the excessive water has been removed. Research indicates that a high-temperature environment is required to realize a flash point hazard with the vapors of these fluids at normal pressure conditions. [17]

In pure form, propylene glycol and glycerin are Class IIIB Combustible Liquids. As discussed above, existing research and testing suggests that the combustibility characteristics of antifreeze-water mixtures in droplet form are not completely characterized by standardized test methods for flash point or autoignition temperature. As such, these methods are not a reliable indication of the potential for ignition of a liquid dispersed into droplets. Under certain conditions, atomized antifreeze-water mixtures can combust when sprayed onto an ignition source. Increasing the concentration of the antifreeze in the antifreeze-water solution increases the combustibility of the solution.

The discussion above describes the complexity of whether a certain antifreeze solution has the potential to ignite when supplied through automatic sprinkler systems. Existing research indicates that under certain conditions the energy released during a fire condition could increase upon interaction with certain antifreeze-water mixtures currently permitted by NFPA 13, 13D and 13R. [18] [19] Recent testing conducted by UL [4] demonstrates that, under certain conditions, a large-scale sustained ignition is possible from the discharge of certain sprinkler systems containing antifreeze solutions. The intent of the Phase II testing is to more completely investigate the potential for large-scale ignition of flash fires from antifreeze solutions and to



investigate the impact on a sprinkler system's ability to control a fire condition and maintain tenable conditions.

### **C. Sprinkler Droplet Sizes and Distributions**

Droplet sizes and distributions produced by automatic sprinklers have been studied using a variety of techniques. Measurements of the droplet sizes produced by automatic sprinklers are relatively complex because the droplet size distribution measured is expected to vary with several factors including:

- Position with respect to the sprinkler in three dimensions
- Sprinkler model
- Operating pressure/flow rate
- Liquid supplied to the sprinkler, e.g. water or antifreeze solution
- Surrounding air currents, including fire induced flows

Even with all of the variables above held constant, measurements include a range of droplet sizes and not a single uniform droplet size. Additionally, it is possible for sprinklers operating with identical k-factors and pressures to have different spray patterns. Sprinklers that have identical orifice sizes (k-factor) can have varying geometric parameters such as arms, deflectors or tines. Changes in any of these geometric parameters may substantially alter the droplet size and distribution. For example, the figure below illustrates sprinkler discharge from two sprinklers with the same k-factor operating under the same pressure, but with spray distribution patterns that are significantly different.

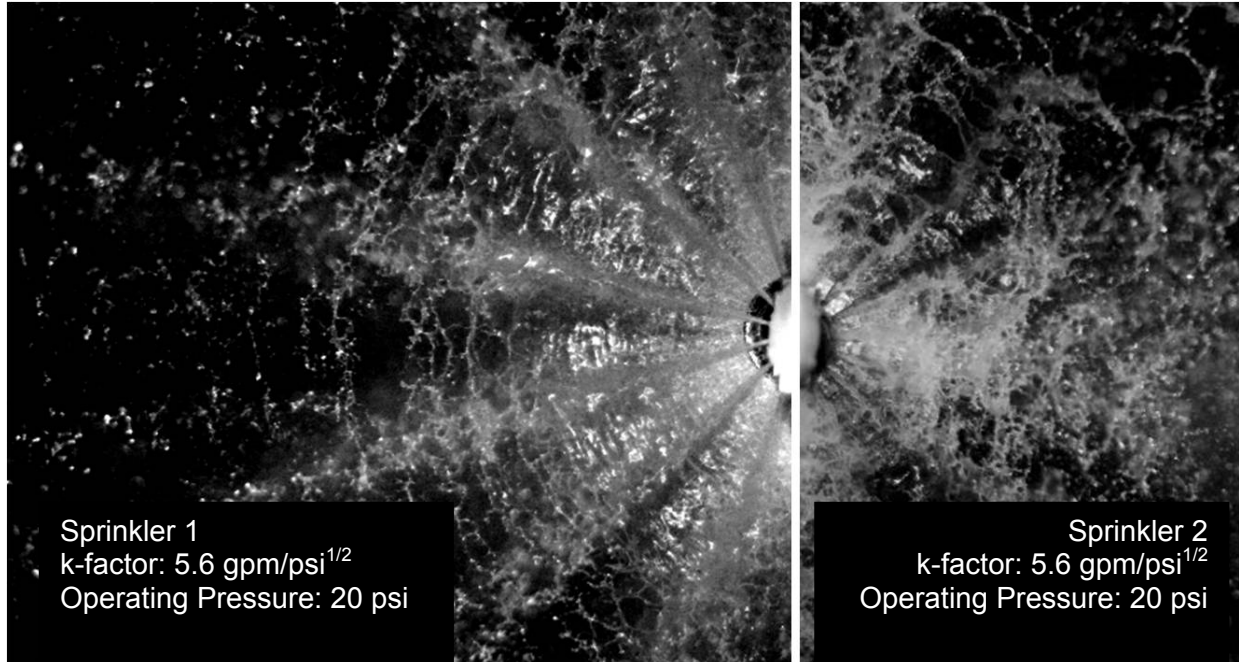


Figure 4. Spray distribution from automatic sprinklers. (Courtesy: Prof. André Marshall, University of Maryland)

Many of the existing methods are point measurement techniques that only measure data at a single point. Point measurement techniques are capable of measuring droplet size and velocity and work well for spherical droplets. However, sprinkler droplets are not always spherical.[20] In addition, point measurements must be taken at various locations in the sprinkler flow so that the results are temporally and spatially averaged. This limits measurement accuracy because fire sprinkler sprays are unsymmetrical and unsteady. Certain areas of the spray distribution are denser than others which may cause results to vary based on measurement locations. [20]

Studies of standard orifice, pendent spray fire sprinklers indicate droplet sizes between approximately 200 and 3,000  $\mu\text{m}$ . [20] This approximation agreed with existing research which indicated that droplets larger than approximately 5,500  $\mu\text{m}$  in diameter are unstable and break up into smaller droplets, predominantly in the range of 1,000 to 2,000  $\mu\text{m}$ . [23] Previous research indicates that while a large number of very small drops are present, they comprise a small portion of the total water volume. Data indicates that 98% of the water from standard orifice fire sprinklers is contained in droplets larger than 200  $\mu\text{m}$  in diameter. [16] A study of residential sprinklers measured water droplets ranging from an arithmetic mean of 200 to over 500  $\mu\text{m}$ , depending on location. [21] However, droplets with diameters of less than 100  $\mu\text{m}$  were measured. [21]



#### **D. Phase I Testing**

During Phase I of this project a series of preliminary tests were sponsored and conducted by Underwriters Laboratories. Tests were conducted in UL's large-scale test facility in Northbrook, IL and several of the tests were witnessed by CCI on behalf of the Foundation.

Initial tests were conducted with a small ceiling above an elevated pan of heptane using residential pendant sprinklers with nominal k-factors of 3.1 and 4.9 gpm/psi<sup>1/2</sup>. The tests used premixed solutions of 70% glycerin and 60% propylene glycol with water. The tests indicated the potential for large-scale ignition of a 70% glycerin solution using a 3.1 k-factor sprinkler at an operating pressure of 100 psi. This large-scale ignition resulted in flames surrounding the majority of the sprinkler spray. A similar large-scale ignition did not occur for initial tests with 60% propylene glycol solutions or tests using a 4.9 k-factor sprinkler at an operating pressure of 50 psi.

Further tests were conducted in a three sided room measuring approximately 12 feet by 12 feet with a ceiling height of 8 feet. A single sprinkler with a k-factor of 3.1 was located in the center of the ceiling for each test. The majority of the room tests were conducted using a nominal 12-inch cast-iron pan with cooking oil as the initial fire source. An electric cooktop was used to heat the pan and ignite the cooking oil. One room test was conducted with a pan of heptane as the initial fire instead of the cooking oil. In various tests, the sprinkler was supplied with water only as well as premixed solutions of 70% glycerin, 50% glycerin, and 60% propylene glycol in water. Sprinkler operating pressures of 20, 100, and 150 psi were investigated.

Test results in the room configuration ranged from extinguishment of the fire to large-scale, sustained ignition of the antifreeze solution. Preliminary observations during the tests indicated that the results depend, at a minimum, on a combination of the following factors:

- Location of the initial fire with respect to the sprinkler
- Initial fire source
- Type of sprinkler and operating pressure
- Type and concentration of antifreeze solution

Large-scale, sustained ignition of the 70% glycerin solution supplied at 100 psi occurred when the initial fire was in close proximity to the sprinkler, but the initial fire was controlled using the same concentration of antifreeze at the same operating pressure when the initial fire was located farther from the sprinkler. Large-scale ignition of the 60% propylene glycol solution occurred in the room configuration during a cooking oil fire, but did not occur in the open



configuration during a heptane fire. Large-scale ignition of the antifreeze solution did not occur in any of the tests with the 50% glycerin solution.

Preliminary observations during the UL testing indicate the following:

- Large-scale ignition of antifreeze solutions occurred in certain tests for 70% solutions of glycerin and 60% solutions of propylene glycol with water.
- Large-scale ignition of antifreeze solutions of 50% glycerin with water did not occur for any of the tested configurations.

Preliminary observations from the tests highlighted the need for further research into the effectiveness of currently permitted antifreeze solutions and consideration of their suitability for use in sprinkler systems.



### **III. Phase II Test Plan and Setup**

The Phase II testing was intended to further study the potential for contribution of antifreeze solutions to fire conditions. The Phase II test plan was separated into two scopes. Scope A tested antifreeze solutions for the potential to create a large-scale ignition of the spray when discharged through sprinklers onto a fire. Scope B tested antifreeze solutions for their impact on a sprinkler system's ability to control a fire condition and maintain tenable conditions.

Tests were conducted with premixed solutions of propylene glycol and glycerin with water obtained from a single commercial distributor. Application of the test results is limited to the solutions tested and not to other formulations of antifreeze solutions that were not tested.

#### **A. Scope A: Room Fire Tests for Spray Ignition using Sprinklers**

Scope A was developed to investigate the potential for ignition of antifreeze solutions supplied by automatic sprinklers. The tests were designed to use a strong, continuous ignition source to identify whether flammable mixtures of antifreeze were created by the antifreeze spray. The tests used several models of residential sprinklers to investigate their impact of the potential for ignition.

Scope A tests were conducted without an enclosure, other than the walls and roof bounding the laboratory. As discussed in the report from Phase I of this project [3], the difference between a flash fire and an explosion is the degree of confinement of the flash fire. Because an explosion could not occur in this context without a flash fire, the flash fires themselves were used as criteria for the tests without the need to evaluate a resulting, enclosure dependant, explosion. While the test setup was designed to avoid explosions within the laboratory, the confinement of flash fires can produce over-pressurizations or explosions.

The test setup for Scope A is illustrated in Figure 5, below.

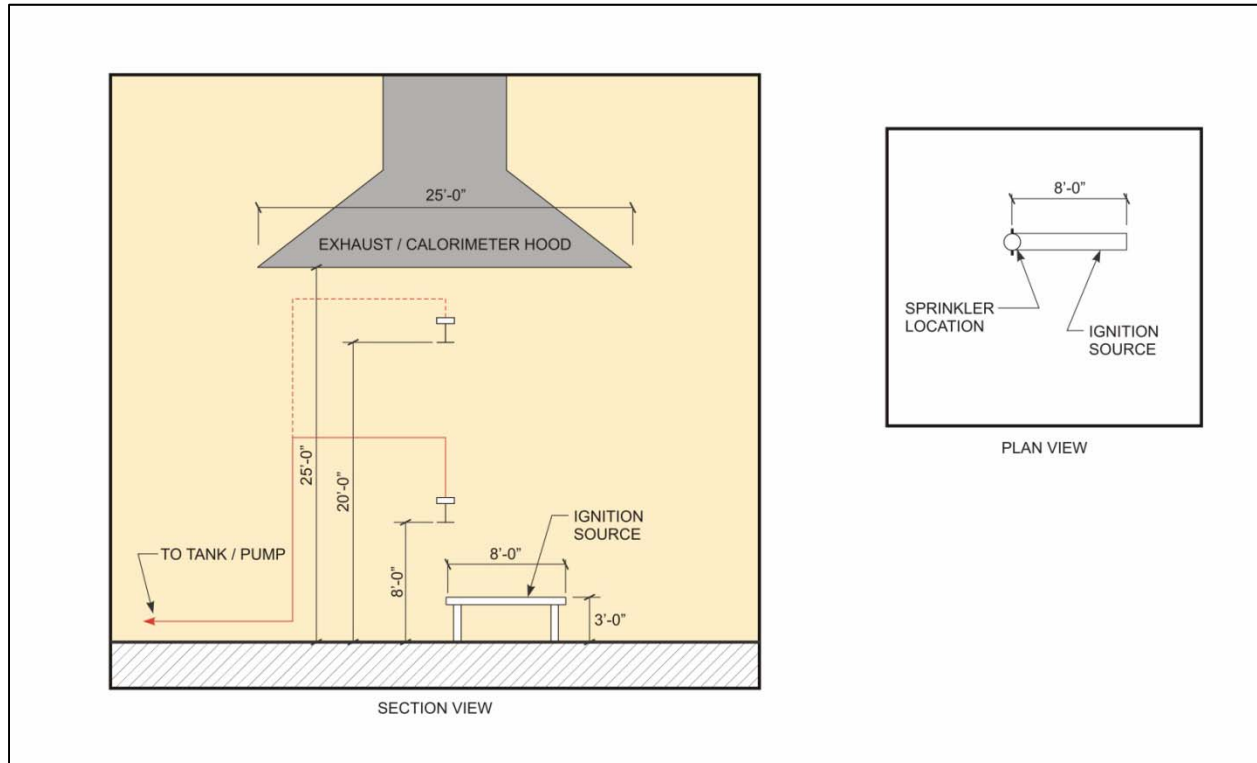


Figure 5. Scope A test setup.

The test setup included a long ignition source that was designed to extend radially from the sprinkler location. The long ignition source allowed a single test to investigate the potential for ignition over a range of locations within the spray pattern. The arrangement allowed for multiple sprinkler heights to be tested and data was collected to allow for heat release rate measurements using oxygen consumption calorimetry.

Initial testing was conducted to investigate appropriate ignition sources. Ignition sources investigated included:

- 6" wide and 12" wide rectangular pans of heptane extended radially from the point directly below the sprinkler.
- 4-nozzle heptane spray burners under a metal grate (the metal grate functions as a hot surface to vaporize antifreeze solution).
- Electric range heating elements (also functioning as a hot surface to vaporize antifreeze solutions).

Figure 6, below, illustrates each of the ignition sources investigated as part of Scope A.

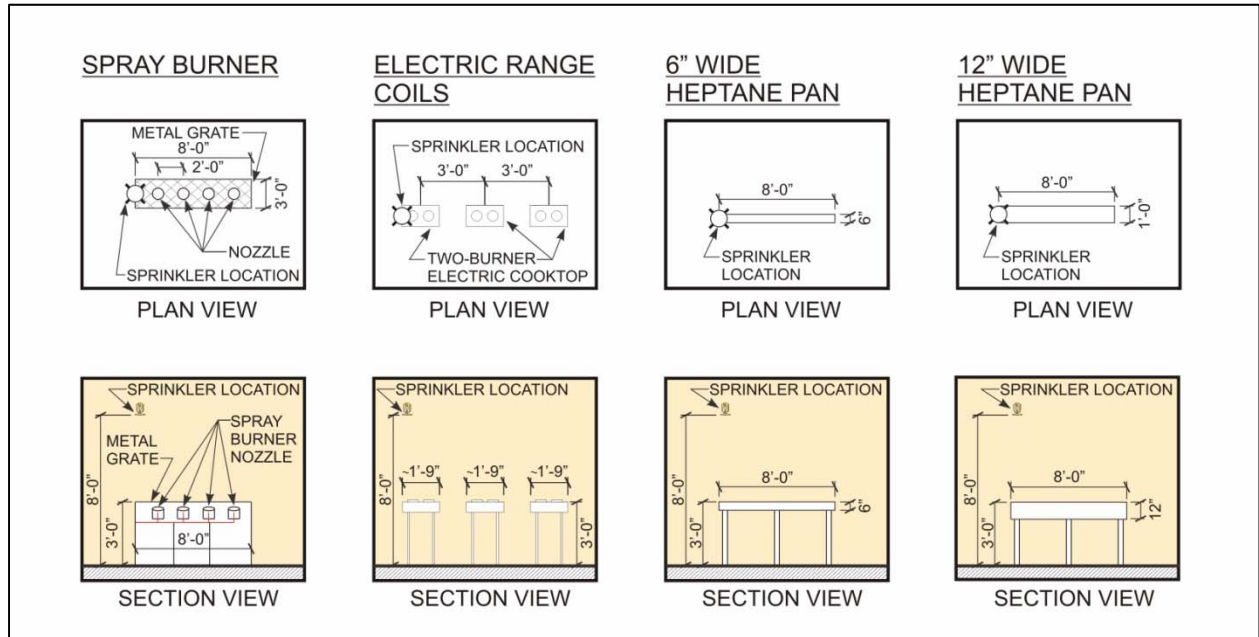


Figure 6. Scope A ignition sources.

The ignition sources are also shown in the photographs below.

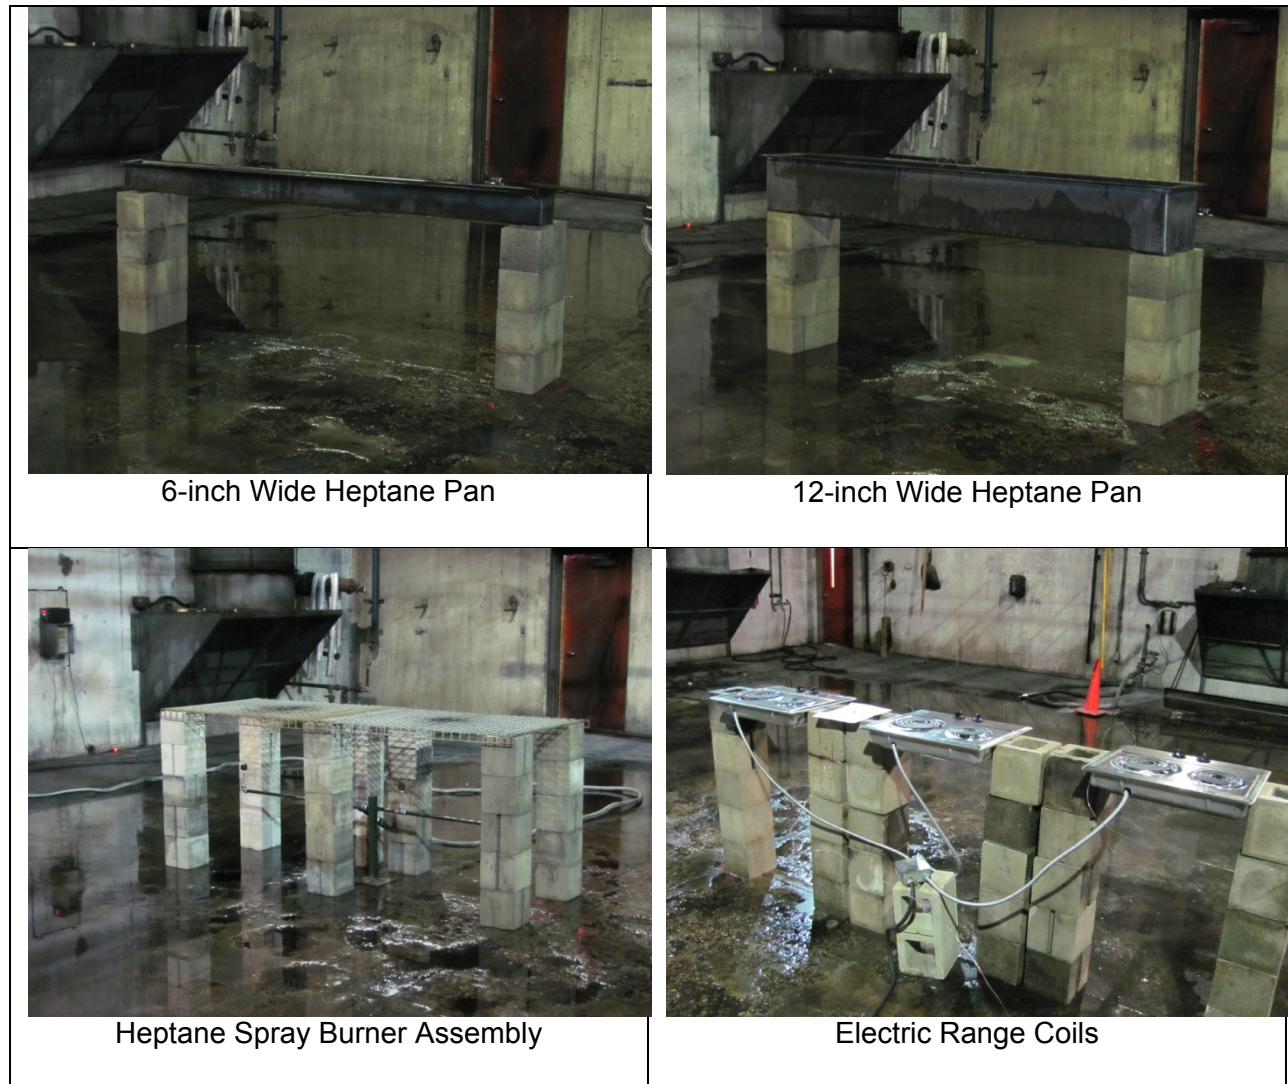


Figure 7. Ignition source photographs.

Ignition sources were tested using solutions of 50% propylene glycol and 60% propylene glycol supplied from a residential pendant sprinkler with a k-factor of 3.1. Prior testing indicated that a 60% propylene glycol solution can be ignited when supplied from a k3.1 sprinkler. Thus, the ignition source selected should be capable of igniting the 60% propylene glycol solution supplied through a k3.1 sprinkler. It was unclear prior to the start of testing whether the 50% propylene glycol solution would be ignited.

The ignition sources selected for the Scope A testing are very unlikely to be extinguished during sprinkler activation. This is unlike most home fire conditions that would be expected to reduce in intensity upon the application of water. Some increase in heat release rate could be expected for the ignition sources, but observations of flash fires or ignition of the spray away from the fire source were considered an immediate failure. The initial testing was also intended to validate



the use of a variable sprinkler operating pressure. Varying the sprinkler operating pressure allowed each test to collect data for a range of sprinkler operating pressures. This approach reduced the overall number of tests conducted and helped yield more complete results.

Following the initial testing, a series of tests was conducted to investigate the potential for ignition of select concentrations of antifreeze for the following variables:

VARIABLE	VALUES TESTED
Antifreeze concentration	<ul style="list-style-type: none"> <li>• Propylene glycol               <ul style="list-style-type: none"> <li>○ 40%, 45%, 50%, 60%</li> </ul> </li> <li>• Glycerin               <ul style="list-style-type: none"> <li>○ 50%, 55%</li> </ul> </li> </ul>
Antifreeze temperature	<ul style="list-style-type: none"> <li>• Ambient 80-90°F</li> <li>• Elevated 140°F</li> </ul>
Sprinkler height	<ul style="list-style-type: none"> <li>• 8 ft</li> <li>• 20 ft</li> </ul>
Horizontal position of ignition source	Considered through the use of a long ignition source that extended radially from the sprinkler
Sprinkler operating pressure	10 to 150 psi (varied in 10 psi increments)
Sprinkler type and nominal k-factor	<ul style="list-style-type: none"> <li>• Fixed deflector residential pendant (k3.1, k4.9, k7.4)</li> <li>• Drop-down deflector (concealed) residential pendant (k4.9, k5.8)</li> <li>• Residential sidewall (k4.2, k5.5)</li> </ul>

The majority of the testing was conducted with solutions of 40%, 50%, and 60% propylene glycol as well as 50% glycerin. Select tests of 45% propylene glycol and 55% glycerin were used to evaluate the sensitivity of the results to the antifreeze concentration.

Ceiling heights of 8 ft and 20 ft were used to evaluate a range of residential applications. The 8 ft ceiling height is typical of many residential spaces and the 20 ft ceiling height is intended to account for a tall, double-height space in a residential occupancy. It was theorized prior to the initial testing that the atomization and dispersion of the droplets in the sprinkler spray would behave differently for varying ceiling heights. The initial testing confirmed that the spray distribution reaching the fire sources changes with the height of the sprinkler.

The Phase I testing demonstrated that the position of the ignition source within the sprinkler spray significantly impacted the potential for ignition of the spray. The long ignition source extending radially from below the sprinkler was used to allow a single test to generate data for a range of ignition source locations.



Data was gathered for a wide range of sprinkler operating pressures by varying the operating pressure during each test. The low pressure (10 psi) was intended to capture data near the minimum flow rates that would be permitted for the larger orifice sprinklers in the test plan. The high pressure (150 psi) was intended as a high pressure anticipated for a typical residential occupancy.

Due to the complex nature of the droplet size and sprinkler spray distribution produced during sprinkler discharge, several different types of sprinklers were selected for the Scope A testing. This approach was used to develop information on how changes in sprinkler geometry (deflector, arms and tines) and orifice size impacted the results.

**B. Scope B: Room Fire Tests of Sprinkler Effectiveness**

The Scope B tests were intended to investigate the effectiveness of residential sprinklers using an antifreeze solution compared with water alone. The Scope B tests were not intended to investigate the potential for large-scale ignition of the sprinkler spray.

The Scope B testing is similar to the UL 1626 fire test, with certain additional variables considered as outlined in the table below.

VARIABLE	VALUES TESTED
Antifreeze solutions	<ul style="list-style-type: none"> <li>• 50% Glycerin</li> <li>• 40% Propylene glycol (single test)</li> <li>• Water alone</li> </ul>
Ceiling height	<ul style="list-style-type: none"> <li>• 8 ft</li> </ul>
Sprinkler operating pressure/flow rate	<ul style="list-style-type: none"> <li>• Minimum permitted flow based on NFPA 13D design criteria                             <ul style="list-style-type: none"> <li>○ Pendant: 18 gpm one sprinkler / 13 gpm each for two sprinklers</li> <li>○ Sidewall: 24 gpm one sprinkler / 17 gpm each for two sprinklers</li> </ul> </li> <li>• 80psi</li> <li>• 150 psi</li> </ul>
Sprinkler type, temperature rating, and nominal k-factor	<ul style="list-style-type: none"> <li>• Ordinary temperature fixed deflector residential pendant (k3.1, k4.9)</li> <li>• Ordinary temperature residential sidewall (k4.2)</li> </ul>
Fire Source	<ul style="list-style-type: none"> <li>• UL 1626 fuel package</li> <li>• Furnished living room (sofa, chair, tables)</li> </ul>

The tests are designed to directly compare the performance of sprinkler systems supplied with antifreeze solutions to the performance of sprinkler systems supplied with water alone. The



tests measured temperature at several locations within the room to evaluate tenability in accordance with the criteria specified in UL 1626. In addition, the test setup included sprinklers installed within the room that were designed to evaluate whether the fire condition would be expected to overwhelm the sprinkler system. Figure 8, below, illustrates the test setup for Scope B.

For the purposes of the Scope B testing, a ceiling height of 8 ft was used. This ceiling height was intended to represent that of a typical residential dwelling.

Similar to the Scope A tests, Scope B tests included multiple sprinkler operating pressures, but the pressure was not varied during each test. The low flow tests were intended to match the NFPA 13D criteria of 18 gpm for the activation of the first sprinkler and 13 gpm per sprinkler for the activation of two sprinklers. For the sidewall sprinklers a minimum flow rate of 24 gpm for the first sprinkler and 17 gpm per sprinkler for the activation of two sprinklers was required based on the listing of the sprinkler. Higher sprinkler operating pressures of 80 and 150 psi were also tested to evaluate their impact on the results.

A range of sprinkler types and models were tested in Scope B. Two sprinklers were located within the test room in accordance with UL 1626 to control the fire condition and a third sprinkler was located near the doorway to the enclosure, as illustrated in Figure 8, below, to investigate the potential for activation of sprinklers away from the area of fire origin. The test enclosure measured 8 ft by 16 ft by 8 ft high, which was within the listed spacing of the k4.9 and sidewall sprinklers. The enclosure was somewhat larger than the 14 ft by 14 ft listed spacing of the k3.1 sprinkler, which provided a severe test of the antifreeze solution.

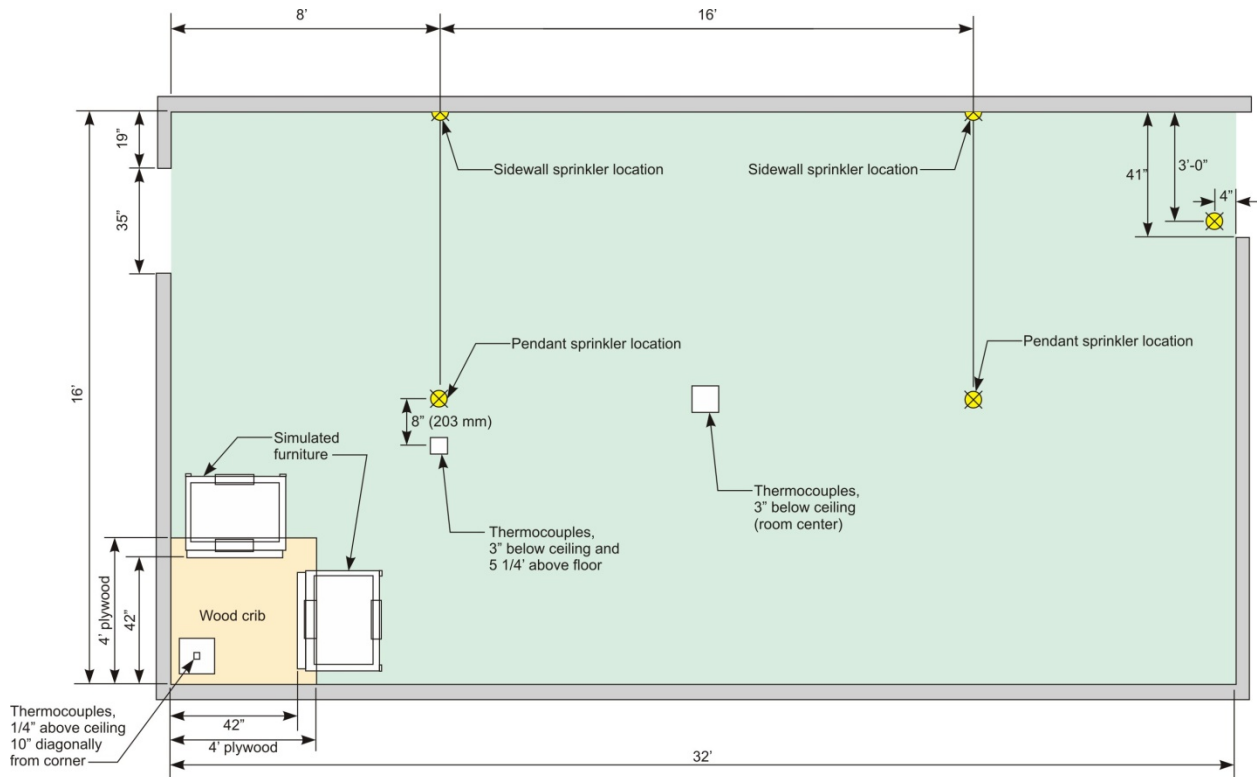


Figure 8. Scope B test setup.

The tests primarily used the fuel package specified in UL 1626 that consists of a wood crib ignited by a pan of heptane that is positioned adjacent to two simulated furniture ends. The potential for fire spread is evaluated by locating the fuel package in the corner of the room with walls covered with wood paneling. In addition to tests with the UL 1626 fuel package, a test was also conducted with a fuel package typical of a residential living room. The fuel package consisted of a sofa, chair, end table, and coffee table, along with a trash can filled with paper.

Failure criterion for the Scope B testing was based on the UL 1626 fire control criteria. Based on these criteria, residential sprinklers installed in a fire test enclosure with an 8-ft ceiling are required to control a fire for 10 minutes with the following limits:

1. The maximum gas or air temperature adjacent to the sprinkler 3 inches below the ceiling at two locations within the room must not exceed 600°F.
2. The maximum temperature 5 feet 3 inches above the floor at a specified location within the room must be less than 200°F during the entire test. This temperature must not exceed 130°F for more than a 2 minute period.
3. The maximum temperature ¼ inch behind the finished surface of the ceiling material directly above the test fire must not exceed 500°F.



4. No more than two residential sprinklers in the test enclosure can operate.

Any variation from the limits outlined above was considered an immediate failure. [24]



## IV. Phase II Test Results

### A. Scope A – Spray Ignition

Initial tests were conducted to investigate potential ignition sources. The tests used solutions of 50% and 60% propylene glycol to investigate the effectiveness of each ignition source in igniting antifreeze sprays. The following graph compares the increase in heat release rate due to ignition of 60% propylene glycol antifreeze spray for each of the ignition sources.

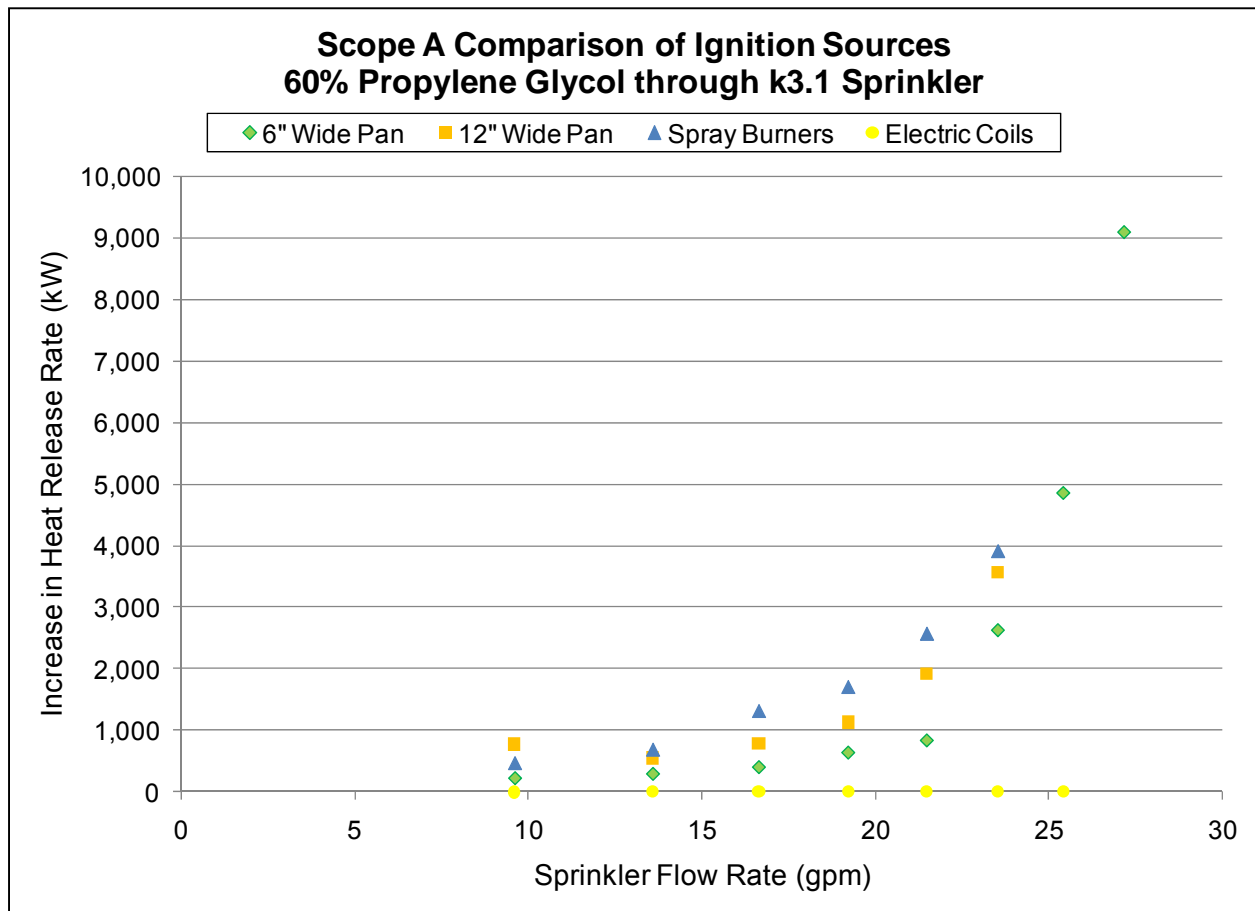


Figure 9: Scope A Comparison of Ignition Sources with 60% Propylene Glycol

Each of the ignition sources, with the exception of the electric range coils, was able to ignite the 60% propylene glycol solution. The increase in heat release rate from the spray burner assembly was somewhat higher than the other ignition sources at the same sprinkler flow rate. Note that the pan and spray burner tests were terminated early due to the size of the resulting fire condition.



Figure 10, below, shows the increase in heat release rate as a function of sprinkler flow rate for a 50% propylene glycol solution using each of the ignition sources that ignited the 60% solution.

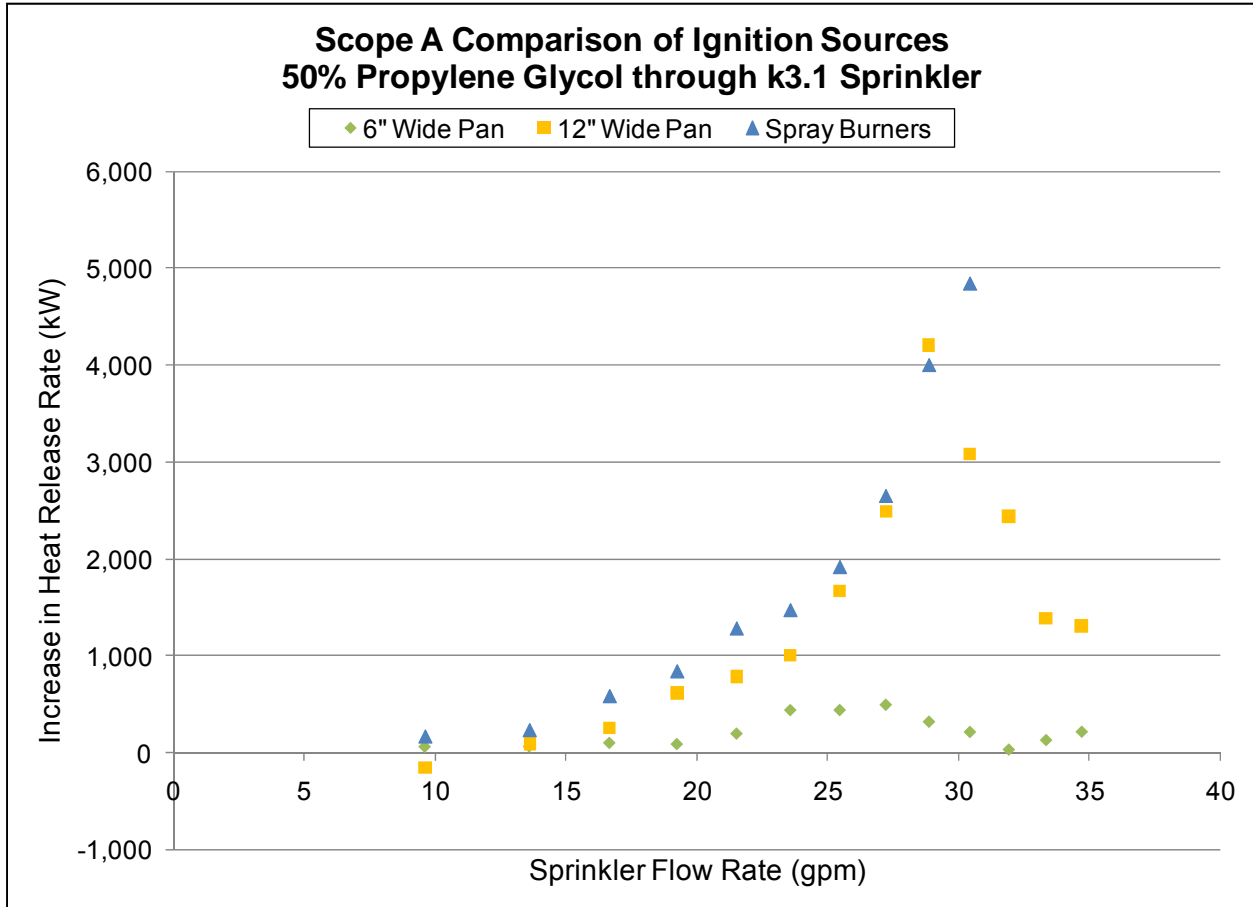


Figure 10. Scope A Comparison of Ignition Sources with 50% Propylene Glycol

The results with the 50% propylene glycol solution show significant differences between the ignition sources. There was very little increase in the heat release rate of the 6-inch wide heptane pan upon application of the antifreeze solution. The 12-inch wide heptanes pan had an initial increase in heat release rate, but higher sprinkler flow rates extinguished portions of the pan fire and reduced the heat release rate. The heat release rate of the spray burner increased throughout the test as the sprinkler flow rate increased.

The heptane spray burner was selected as the ignition source for the remaining tests based on its ability to efficiently ignite sprays of both the 50% and 60% propylene glycol solutions. As illustrated in Figure 10, above, the heptane spray burner represented the worst-case ignition source of those investigated, because it was not extinguished by the 50% propylene glycol



solution. Additionally, the heptane spray burner produced a steady baseline fire size that increased the overall reproducibility and reliability of the ignition source.

Tests were conducted by lighting the heptane burners, adjusting the heptane flow rate, allowing for a 2 minutes of heating, and flowing antifreeze solution to an open sprinkler. The sprinkler operating pressure was typically varied during each test from 10 psi to 150 psi, unless the test was terminated early due to the growth of the fire condition.

The tests investigated the impact of several variables in causing ignition of antifreeze sprays.

1. Sprinkler

Tests of 50% propylene glycol solution were conducted for the full range of sprinklers investigated. The graph that follows shows the increase in heat release rate due to an antifreeze spray of 50% propylene glycol for the range of sprinklers.

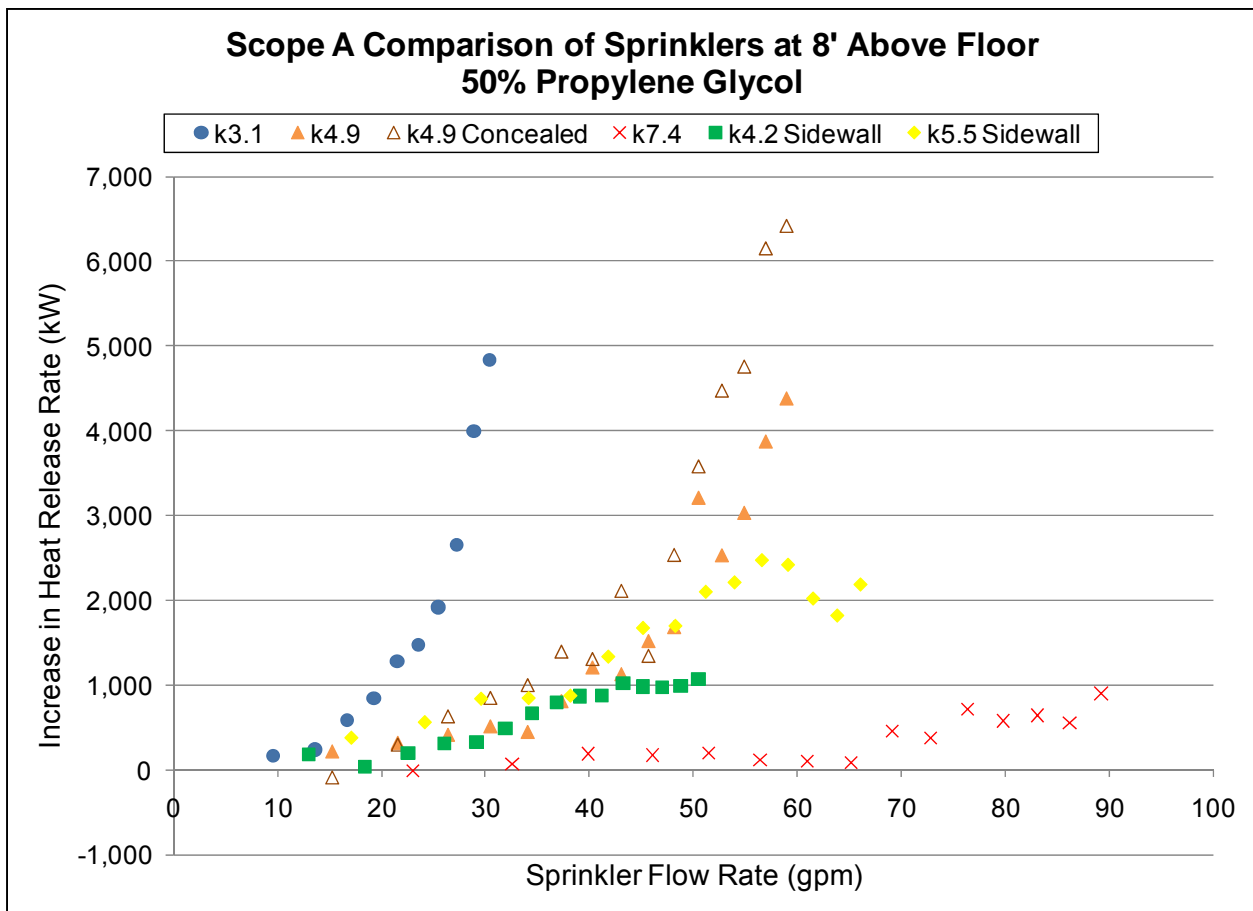


Figure 11: Comparison of Sprinklers at 8' Above Floor with 50% Propylene Glycol



The results presented in Figure 11, above, show that a 50% propylene glycol solution results in a significant increase in the size of the initial fire when supplied by certain sprinklers. Data for three of the six sprinklers tested shows an increase of more than 4,000kW or 300% in the heat release rate due to the application of 50% propylene glycol antifreeze solution depending on the operating pressure. Very little ignition of the spray was observed during the test with the k7.4 pendant sprinkler. The results for the two k4.9 pendant sprinklers show that the portion of the spray that is ignited can differ for sprinklers with the same k-factor. For example, at a flow of approximately 55 gpm the increase in heat release rate during the test with the k4.9 pendant sprinkler was approximately 3,000 kW compared with more than 4,500 kW in the test with a concealed sprinkler. Further testing primarily used the k3.1 and k4.9 concealed sprinklers based on the results outlined above.

## 2. Antifreeze Solution

Scope A tests were conducted for solutions of 40%, 45%, and 50% propylene glycol as well as 50% and 55% glycerin. Results of the tests are summarized in Figure 12, below, which shows the increase in heat release rate due to the application of each antifreeze solution using the same sprinkler and ignition source.

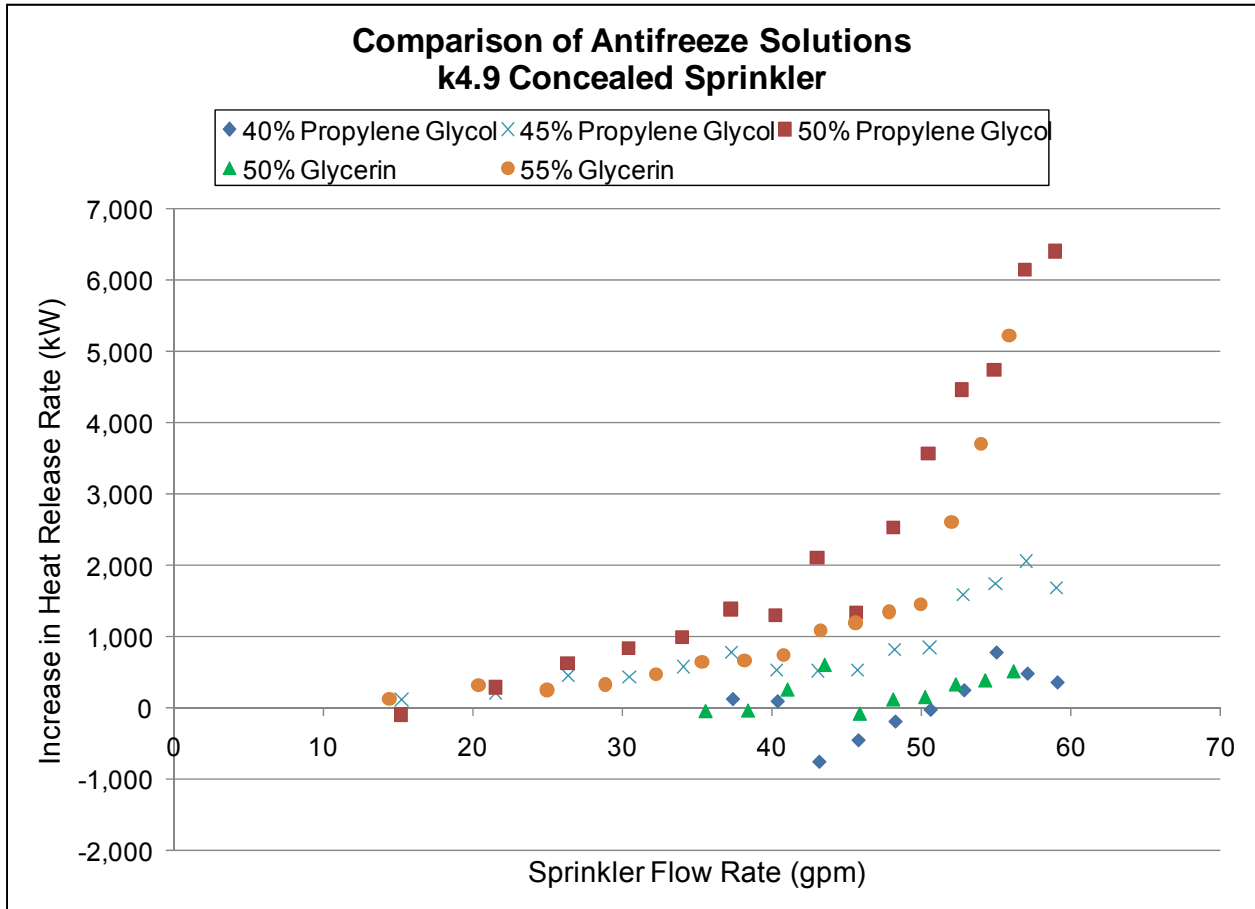


Figure 12: Increase in fire size for various antifreeze solutions.

The results presented above show increases in heat release rate of more than 6,000 kW or 500% for the 50% propylene glycol and 55% glycerin solutions at certain flow rates. This is due in large part to ignition of the antifreeze spray extending away from the initial fire condition. A significantly lower increase in heat release rate was measured for the 45% propylene glycol solution, which showed little ignition of the sprinkler spray away from the ignition source. The application of antifreeze solutions of 40% propylene glycol and 50% glycerin resulted in much smaller changes in heat release rate during otherwise identical test conditions. The 40% propylene glycol and 50% glycerin solutions resulted in very similar changes in the heat release rate of the fire condition. Although there was some increase in the heat release rate that was measured for both solutions at certain operating pressures, flames were not observed to extend away from the initial fire source.

Figures 13 and 14, below, illustrate the maximum increase in heat release rate caused by 50% glycerin solution for tests with sprinklers at 8 ft and 20 ft above the floor, respectively. The maximum heat release rate measured for the test at 8 ft was approximately 3,300 kW



and 2,800kW for a test at 20 ft, compared with a baseline ignition source heat release rate of approximately 1,400 kW.

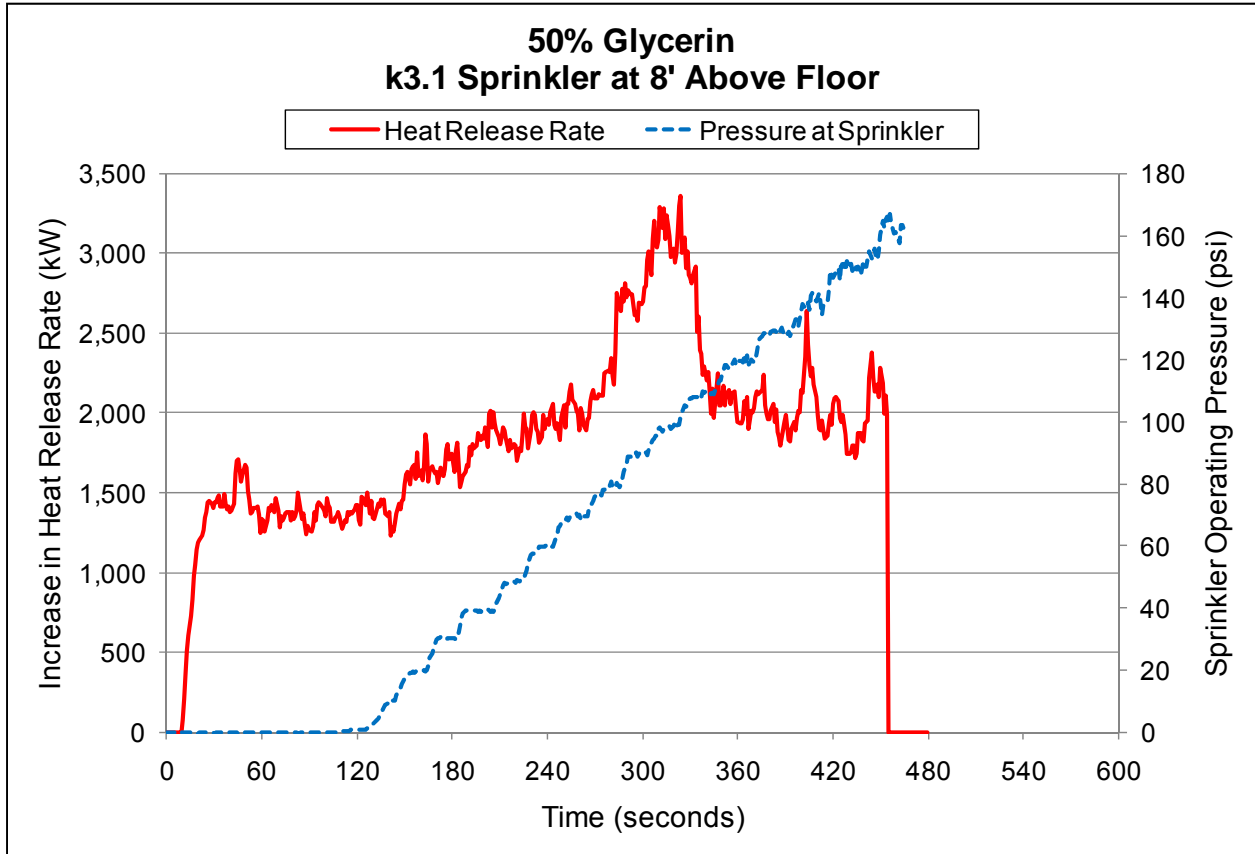


Figure 13. Detailed results for 50% glycerin supplied through k3.1 sprinkler at 8 ft.

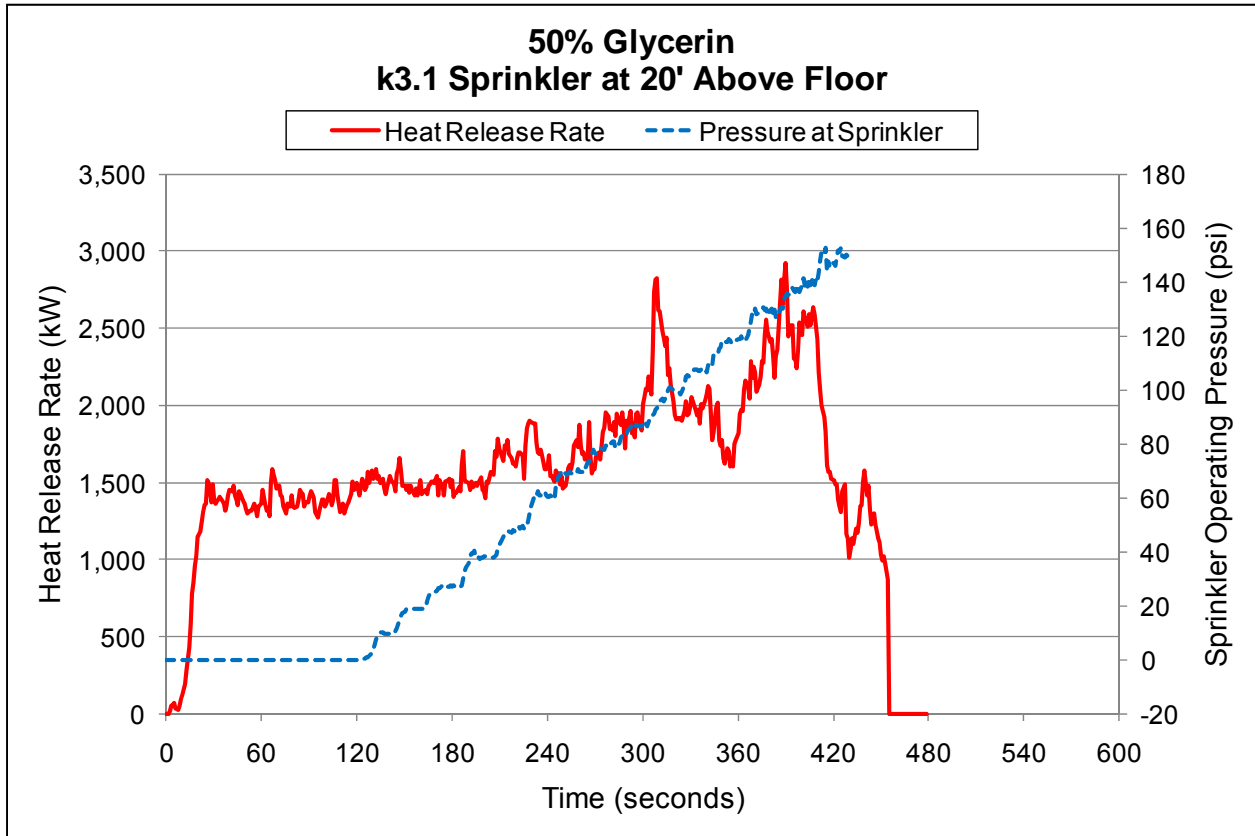


Figure 14: Detailed results for 50% glycerin supplied through k3.1 sprinkler at 20 ft.

### 3. Sprinkler Height

Tests were conducted for solutions of 40%, 50% and 60% propylene glycol for sprinkler heights of 8 feet and 20 feet. Results of the tests are summarized in Figure 15, below, which shows the increase in heat release rate due to the change in ceiling height for each antifreeze solution using the same sprinkler and ignition source.

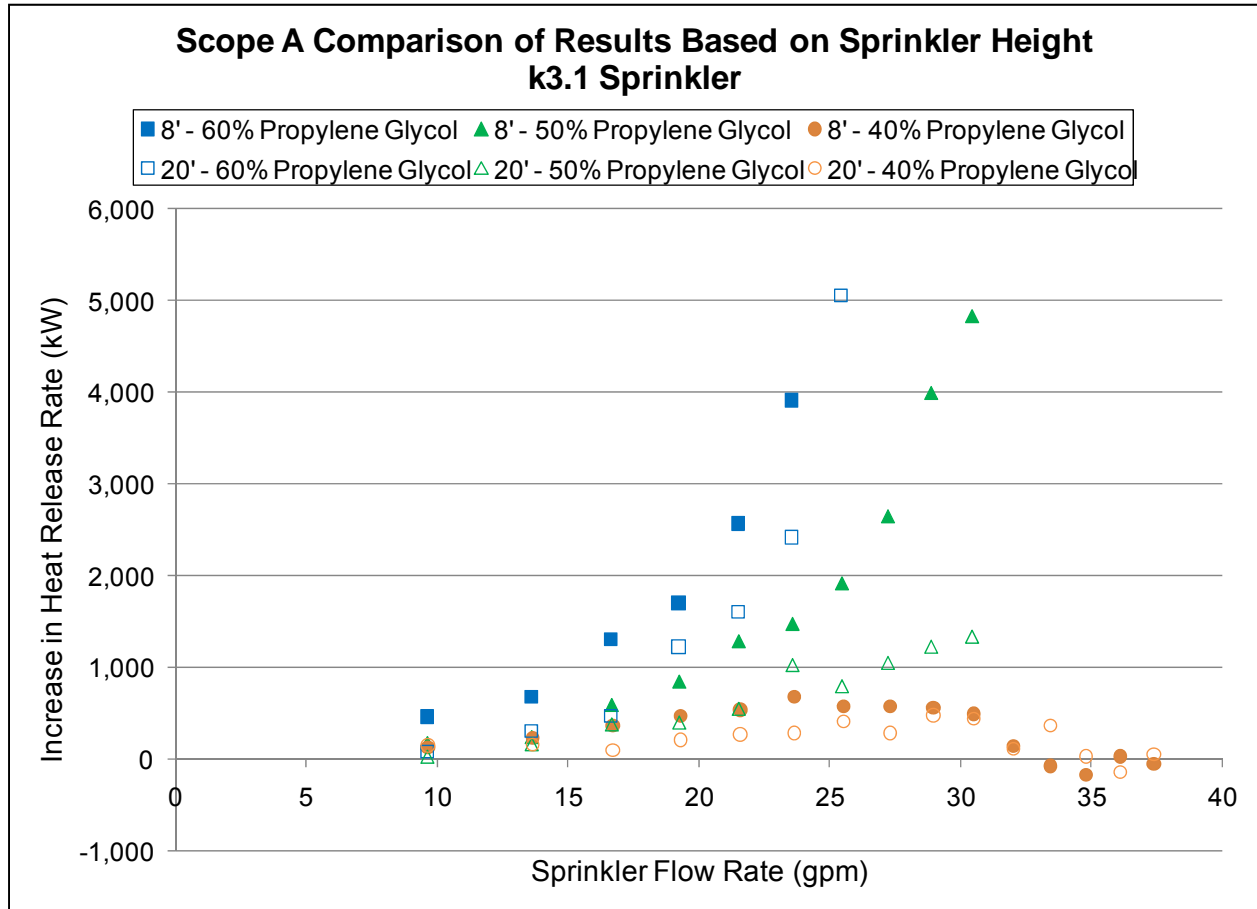


Figure 15: Comparison of Results Based on Sprinkler Height

The results presented above show that for 40% and 60% propylene glycol solutions, the height of the sprinkler had a less significant effect on the increase in heat release rate. The 40% solution resulted in very little increase in heat release rate regardless of the sprinkler height and the 60% solution resulted in a substantial increase in the heat release rate for both sprinkler heights. However, the height of the sprinkler had a significant impact on the results with the 50% propylene glycol solution, particularly at higher flow rates. The 50% propylene glycol solution discharged at a height of 8 ft had an increase in heat release rate of approximately 5,000 kW while discharge at a height of 20 ft yielded an increase in heat release rate of approximately 1,200 kW. Thus, while the sprinkler and antifreeze concentration seem to be of primary importance in determining the potential for ignition, the change in spray distribution with height can significantly impact the results for marginal solutions.



#### 4. Temperature of Antifreeze Solution

Tests were conducted that compared the performance of glycerin solution at ambient temperature (80°F to 90°F) and glycerin solution heated to 140°F. Results of the tests are summarized in Figure 16, below, which illustrates the increase in heat release rate for heated and unheated 50% glycerin solutions.

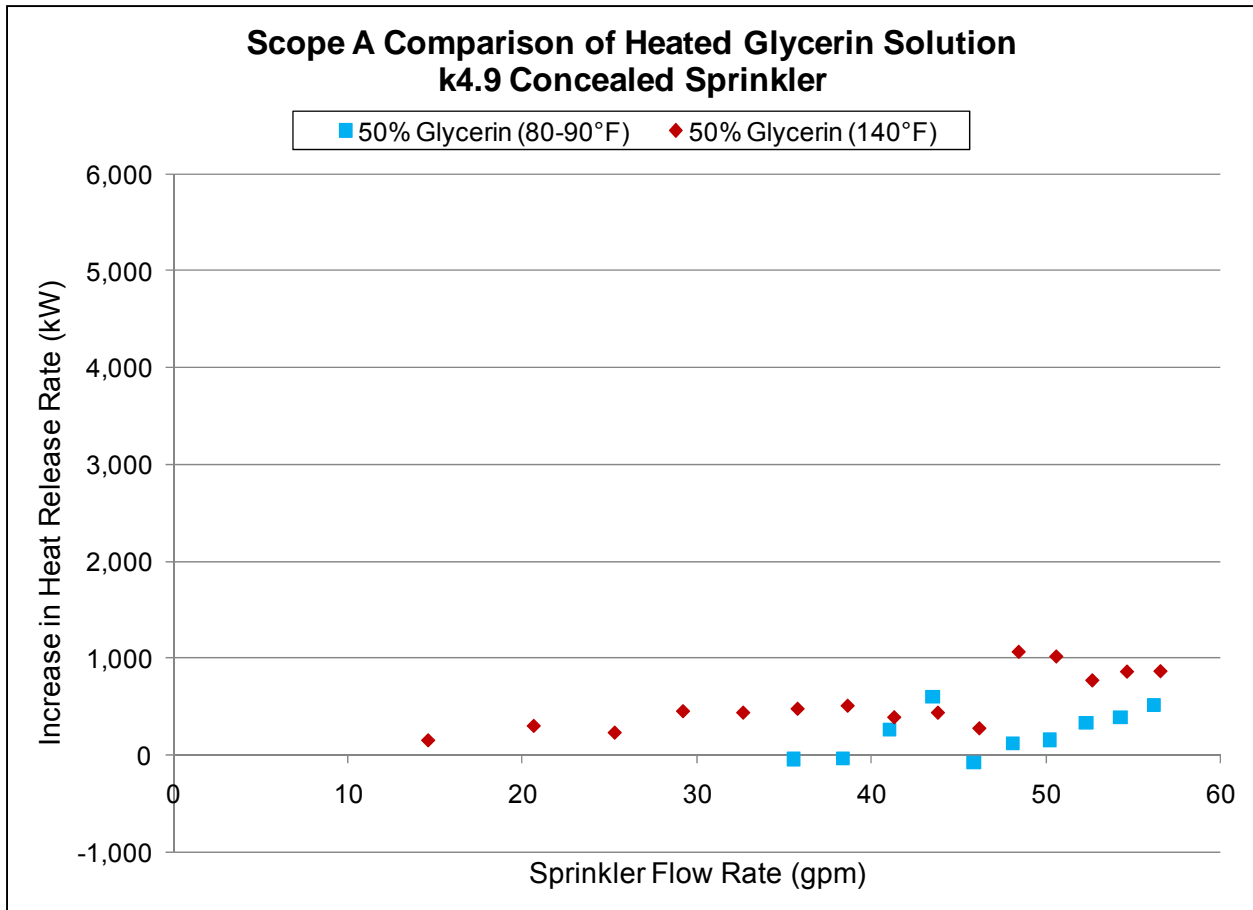


Figure 16: Comparison of Heated Glycerin Solution

The results presented above shows a minor difference in heat release rate during tests with ambient temperature and heated glycerin solutions. Each of the solutions produced a maximum increase in heat release rate of approximately 500 to 1,000kW. While there may be some difference based on temperature over the range investigated, it appears that the effect of temperature is minor compared with the impact of solution concentration.



## B. Scope B – Room Fire Tests

Failure criterion for the Scope B testing was based on the UL 1626 fire control criteria. Based on these criteria, residential sprinklers were installed in a fire test enclosure with an 8-ft ceiling and are required to control a fire for 10 minutes within the limits established by the UL 1626 fire control criteria. UL 1626 includes provisions for extending the duration of the test to 30 minutes if continued burning is observed at 10 minutes, but the test duration was limited to 10 minutes for the purposes of this comparison.

### 1. Temperature 3 inches Below Ceiling

Tests were conducted to ensure that the maximum temperature adjacent to the sprinkler 3 inches below the ceiling did not exceed 600°F. Figure 17, below, illustrates the results of these tests.

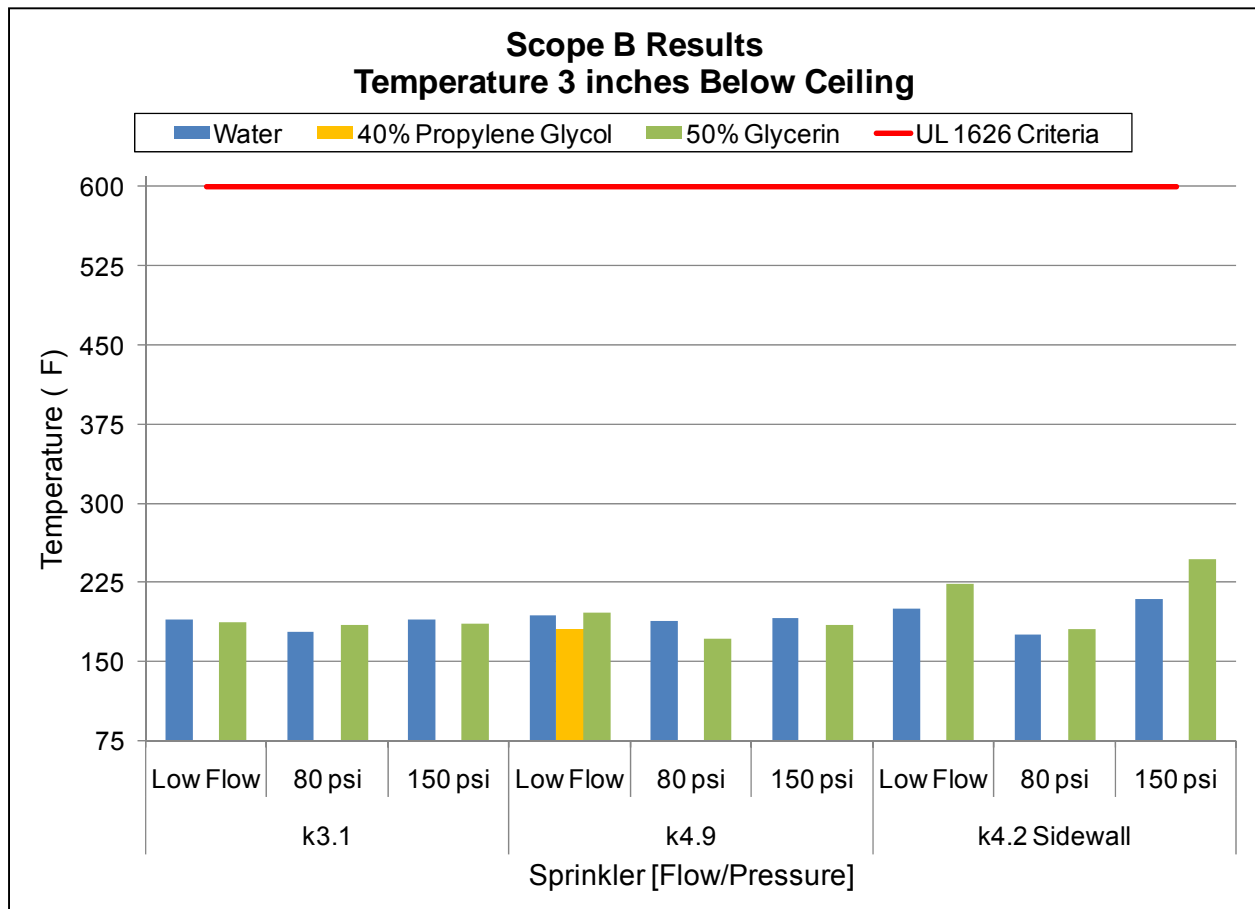


Figure 17: Scope B Results Temperature 3 inches Below Ceiling

The results in Figure 17, above, show that water, 40% propylene glycol, and 50% glycerin demonstrate similar performance. Regardless of variation in sprinkler operating pressure



and k-factor, both of the antifreeze solutions and water did not exceed a measured temperature of 225°F. This is well below the maximum temperature of 600°F specified in the UL 1626 fire control criteria.

2. Temperature at 5'-3" Above Floor

Temperature results at 5'-3" above the floor are illustrated in Figures 18 and 19, below. Figure 18 shows the maximum temperature measured during the test, which is limited by UL 1626 to 200°F, and Figure 19 shows the temperature that is sustained for 2 minutes during the test, which must be less than 130°F based on the criteria in UL 1626.

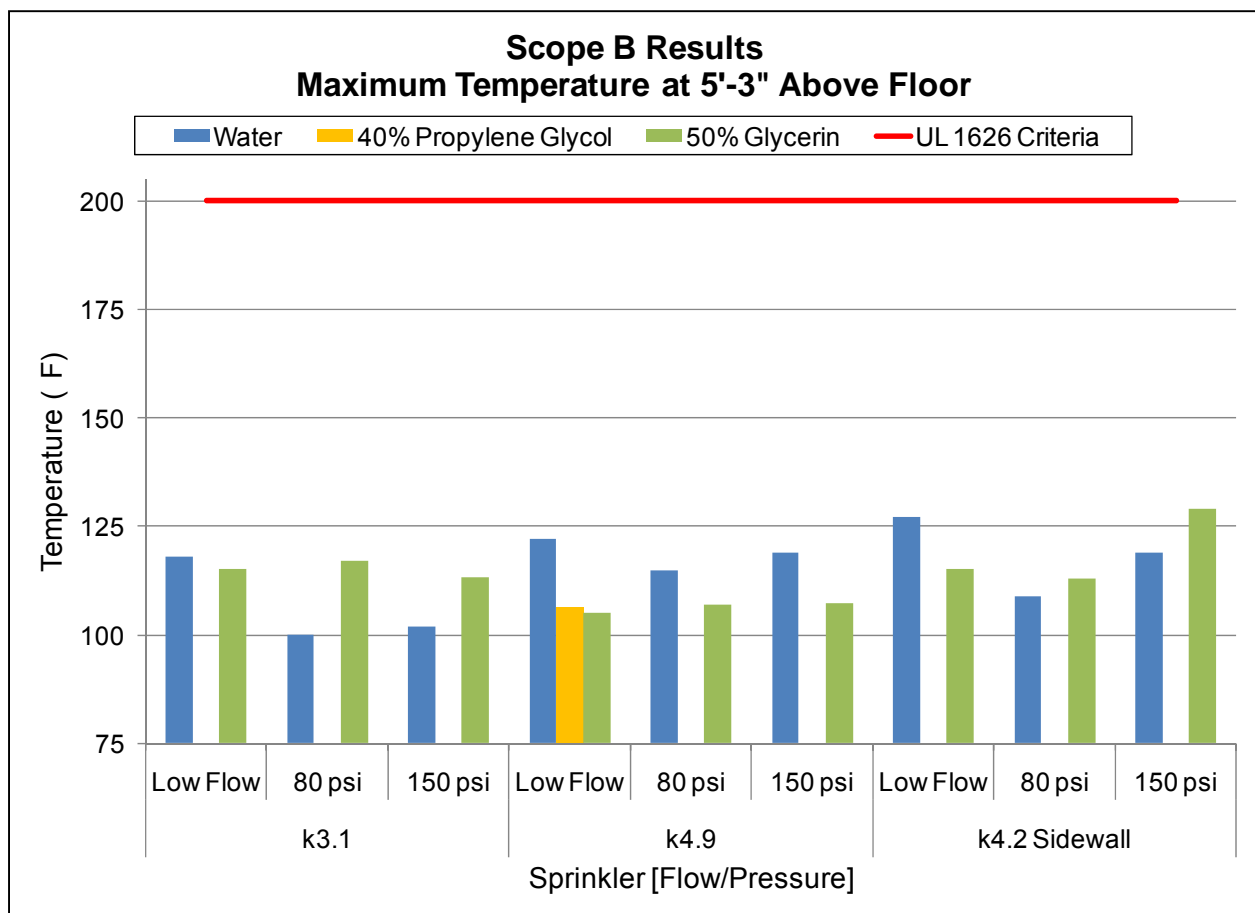


Figure 18: Maximum Temperature 5'-3" Above Floor

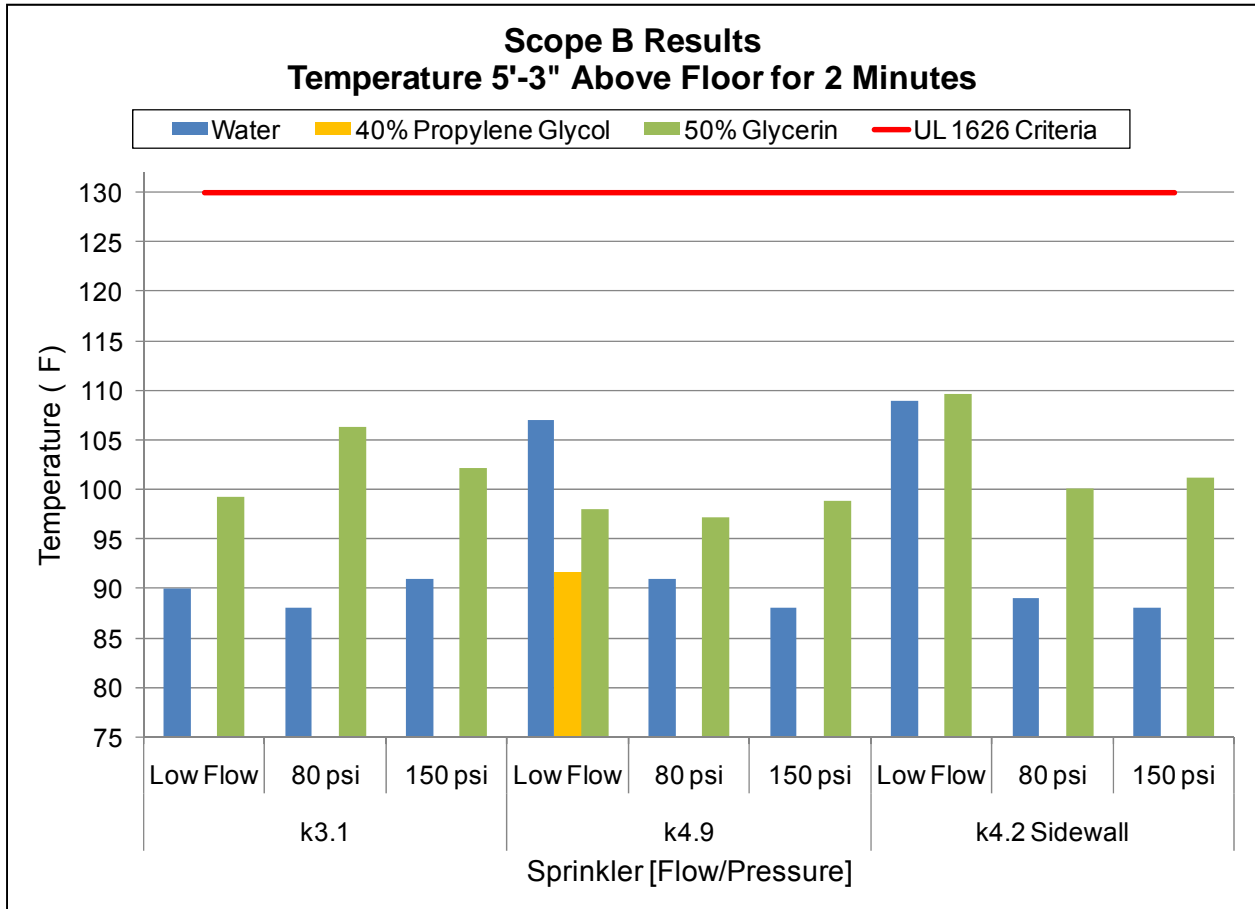


Figure 19: 2 minute Sustained Temperature at 5'-3" Above Floor

All of the tests remained well below the temperature criteria specified in UL 1626. The maximum temperature for water and 50% glycerin were each slightly higher than 125°F compared with a criteria of 200°F. For the low flow condition and the 2 minute temperature criteria, the results with the 50% glycerin solution were better than water for the test with the k4.9 sprinkler, the results with water were better for the k3.1 sprinkler, and the results with the k4.2 sidewall sprinkler were nearly the same. The results for the 2 minute temperature criteria in the tests at 80 psi and 150 psi show somewhat higher temperatures with the 50% glycerin solution compared with water. This may be due in part to the flow rate of glycerin solution being lower than the flow rate of water at the same pressure, which should be accounted for in the design of a sprinkler system. Overall, the temperature results at 5'-3" above the floor were similar with water, 40% propylene glycol, and 50% glycerin.

### 3. Temperature ¼-inch Behind Ceiling Surface

The temperature results at ¼-inch behind the ceiling surface above the fire are illustrated in Figure 20, below.

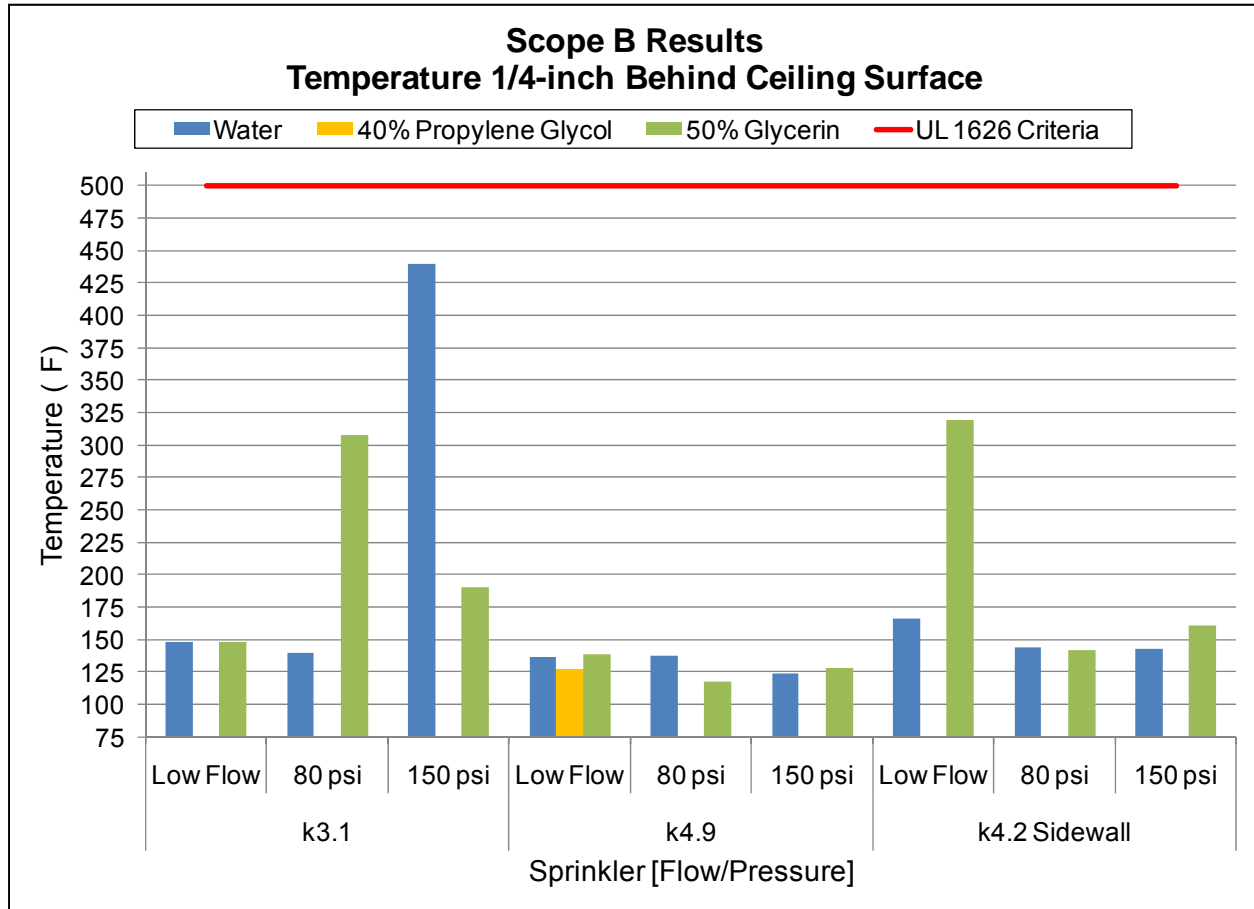


Figure 20: Temperature 1/4-inch Behind Ceiling Surface

As shown in the figure above, the majority of the tests had similar results and all of the tests remained within the criteria specified by UL 1626. In two of the configurations the test with 50% glycerin solution had significantly higher temperatures than the similar test with water and in one of the configurations the test with water had significantly higher temperatures than the similar test with glycerin solution. The highest measured temperature behind the ceiling material was during the test with the k3.1 sprinkler supplied with water at 150 psi. This result is likely due to the test room being larger than the listed protection area of the sprinkler; however, the same test configuration with 50% glycerin solution better controlled the fire condition.

#### 4. Number of Sprinkler Activated

The UL 1626 criteria allows no more than two of the three sprinklers in the room to activate for a successful test. Figure 21, below, shows that the number of sprinklers activated met this criteria for each of the tests.

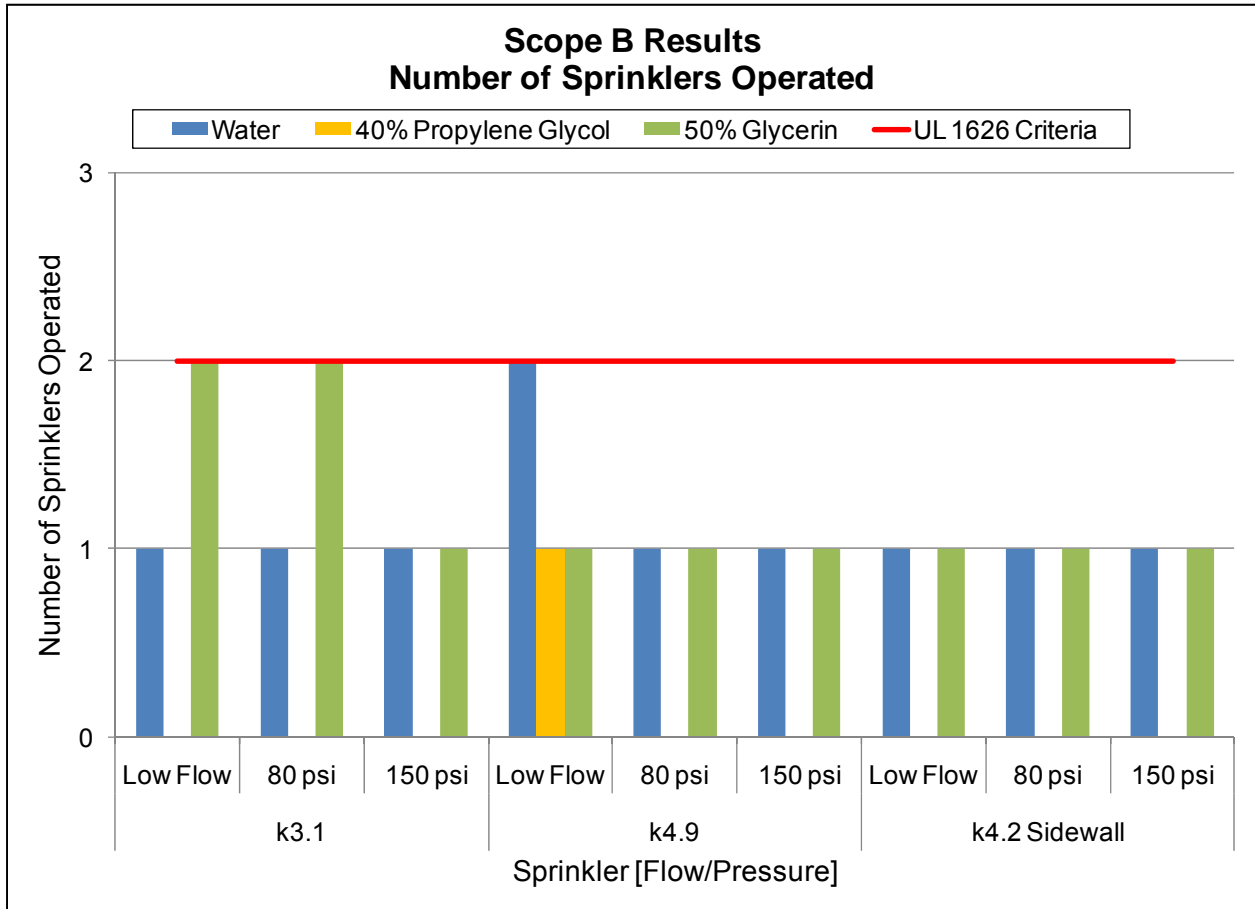


Figure 21: Scope B Results Number of Sprinklers Operated

Two sprinklers were activated in the enclosure during two of the tests with glycerin solution and one of the tests with water. For the remaining tests only a single sprinkler activated. Based on the results of these tests, as illustrated above, the UL 1626 criteria was satisfied.

### 5. Scope B Summary

The results for Scope B are summarized in Table 5, below, along with the UL 1626 criteria.



Sprinkler [Flow/Pressure]	Temperature 3" Below Ceiling	Temperature 5'-3" Above Floor		Temperature Behind Ceiling Material	No. of Sprinklers Activated
	Maximum (°F)	Maximum (°F)	2-Minute (°F)	Maximum (°F)	Maximum
<b>UL 1626 Criteria</b>	<b>600</b>	<b>200</b>	<b>130</b>	<b>500</b>	<b>2</b>
k3.1 Low Flow					
Water	190	118	90	148	1
50% Glycerin	188	115	99	148	2
k3.1 80 psi					
Water	178	100	88	140	1
50% Glycerin	184	117	106	308	2
k3.1 150 psi					
Water	190	102	91	440	1
50% Glycerin	186	113	102	190	1
k4.9 Low Flow					
Water	193	122	107	137	2
40% Propylene Glycol	180	106	92	127	1
50% Glycerin	196	105	98	139	1
k4.9 80 psi					
Water	189	115	91	138	1
50% Glycerin	172	107	97	117	1
k4.9 150 psi					
Water	191	119	88	124	1
50% Glycerin	185	107	99	128	1
k4.2 Sidewall Low Flow					
Water	200	127	109	166	1
50% Glycerin	223	115	110	319	1
k4.2 Sidewall 80 psi					
Water	175	109	89	144	1
50% Glycerin	180	113	100	142	1
k4.2 Sidewall 150 psi					
Water	209	119	88	143	1
50% Glycerin	246	129	101	161	1
Furniture Fire k4.9 Low Flow					
50% Glycerin	165	96	94	104	1
<b>Without Sprinklers</b>	<b>&gt; 1,074</b>	<b>&gt; 545</b>	<b>&gt;130</b>	<b>&gt; 571</b>	<b>N/A</b>

Table 5. Scope B Test Results



In addition to the results of tests with the UL 1626 fuel package, Table 5 also includes the results of a test conducted with living room furniture. The test used 50% glycerin solution supplied to a k4.9 sprinkler at 18 gpm. The fire was controlled by one sprinkler. The results of the test indicate that the UL 1626 fuel package is a more severe test of the sprinkler system than the living room furniture fuel package. The temperatures measured during the test with actual furniture were lower than any of the tests with the UL 1626 fuel package.

Table 5 also includes results of a UL 1626 type test conducted by Underwriters Laboratories without the use of sprinklers. The test without sprinklers was conducted as part of a prior research project and used a 12 ft by 24 ft enclosure meeting the requirements of UL 1626. The test was terminated after less than 4 minutes when the temperature in the room exceeded 1,000°F. While all of the Scope B tests with antifreeze solutions and water maintained temperatures within the UL 1626 criteria for a full 10 minutes, a similar test without sprinklers resulted in flashover of the enclosure in less than 4 minutes. The results demonstrate the effectiveness of water as well as solutions of 40% propylene glycol and 50% glycerin in controlling home fire conditions represented by UL 1626.



## V. Summary

A test plan was developed for Phase II to investigate the potential for large-scale ignition of antifreeze solutions discharged from residential sprinklers. This test plan also explored the influence of antifreeze solutions on the effectiveness of residential sprinkler systems in controlling a fire condition and maintaining tenable conditions for egress.

Testing was conducted in two parts (Scope A and B). Scope A consisted of fire tests using six (6) models of sprinklers operating at pressures of 10 psi to 150 psi at elevations of eight and twenty feet. The Scope A testing was intended to investigate the potential for large-scale ignition of antifreeze sprays at pressures ranging from 10 psi to 150 psi. Scope B consisted of room fire tests, similar to UL 1626, that were designed to investigate the effectiveness of sprinklers discharging antifreeze solutions and their ability to maintain tenable conditions.

Results of the Scope A testing indicated that concentrations of propylene glycol exceeding 40% by volume and concentrations of glycerin exceeding 50% by volume have the potential to ignite when discharged through automatic sprinklers. The potential for ignition depends on several factors including the ignition source, sprinkler model, sprinkler elevation, and discharge pressure. Ignition of antifreeze spray increased the measured heat release rate in certain tests with 50% propylene glycol and 55% glycerin by more than 300%. For certain test conditions, the increase in heat release rate resulting from the application of 55% glycerin solution exceeded the increase in heat release rate from the application of 50% glycerin solution by a factor of 10. A similar level of sensitivity was observed between 40% and 50% propylene glycol solutions, but not between 40% and 45% propylene glycol solutions.

The results of the Scope B testing indicated that concentrations of propylene glycol not exceeding 40% by volume and concentrations of glycerin not exceeding 50% by volume have similar performance to water as compared to the UL 1626 fire control criteria. Test with the 40% propylene glycol and 50% glycerin solution met the UL 1626 fire control criteria and demonstrated similar performance to water throughout many of the tests.

The results of this research suggest that antifreeze solutions of propylene glycol exceeding 40% and glycerin exceeding 50% by volume are not appropriate for use in home fire sprinkler systems. Consideration should be given to an appropriate safety factor for concentrations of antifreeze solutions that are permitted by future editions of NFPA 13. In addition, based on the flammability properties outlined in Table 4, the use of solutions of diethylene glycol and ethylene glycol in home fire sprinkler systems should also be limited.



## VI. References

- [1] National Board of Fire Underwriters, *NBFU Pamphlet No. 13: Standards of the National Board of Fire Underwriters for the Installation of Sprinkler Equipments as recommended by the National Fire Protection Association*. Chicago, 1940.
- [2] National Fire Protection Association, *NFPA 13: Automatic Sprinkler Systems Handbook*, J. D. Lake, Ed. Quincy, MA, 2010.
- [3] Code Consultants, Inc., "Literature Review and Research Plan, Antifreeze Solutions in Home Fire Sprinkler Systems," 2010.
- [4] Underwriters Laboratories Inc., "Fire Test Data Summary for Residential Sprinklers Discharging Antifreeze Solutions," Northbrook, 2010.
- [5] National Fire Protection Association, *NFPA 13, Standard for the Installation of Sprinkler Systems*. Quincy, MA: National Fire Protection Association, 2010.
- [6] National Fire Protection Association, *Standard for the Installation of Sprinkler Systems in One- and Two-Family Dwellings and Manufactured Homes*. Quincy: National Fire Protection Association, 2010.
- [7] National Fire Protection Association, *NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height*. Quincy: National Fire Protection Association, 2010.
- [8] National Fire Protection Association, *Standard for the Installation of Sprinkler Systems, NFPA 13*. Boston, 1953.
- [9] The Dow Chemical Company. (2003) A Guide to Glycol.
- [10] (2010, July) The Dow Chemical Company. [Online].  
<http://www.dow.com/glycerine/resources/physicalprop.htm>
- [11] (2010, July) The Dow Chemical Company. [Online].  
<http://www.dow.com/glycerine/resources/physicalprop.htm>
- [12] (2010, July) The Dow Chemical Company. [Online].  
<http://www.dow.com/glycerine/resources/physicalprop.htm>
- [13] V. Babrauskas, *Ignition Handbook*. Issaquah, WA: Fire Science Publishers, 2003.
- [14] National Fire Protection Association, "Fire Hazard Properties of Flammable Liquids, Gases, and Volatile Solids," Quincy, MA, NFPA 325M, 1991.
- [15] S. Mannan, Ed., *Lees' Loss Prevention in the Process Industries: Hazard Identification, Assessment and Control*, 3rd ed. Burlington, MA: Elsevier, Inc., 2005.
- [16] M.G. Zabetakis, "Flammability Characteristics of Combustible Gases and Vapors," U.S. Dept. of the Interior, Bureau of Mines, Bulletin 627, 1965.
- [17] J.M. Kuchta, "Investigation of Fire and Explosion Accidents in the Chemical, Mining, and Fuel-Related Industries – A Manual," U.S. Dept. of the Interior, Bureau of Mines, Bulletin 680, 1985.
- [18] M. Arvidson, "An Evaluation of Anti-Freeze for Automatic Sprinkler Systems," SP Swedish National Testing and Research Institute, Boras, Sweden, Brandforsk Project 631-961, 1999.
- [19] J. L. de Ris, M., M. Whitbeck, and J. B. Hankins, "; K-25 Suppression Mode Sprinkler Protection for Areas Subject to Freezing," Factory Mutual Research Corporation, Technical



Report J.I. 0003004619, 2000.

- [20] A.D. Putorti, "Simultaneous Measurements of Drop Size and Velocity in Large-Scale Sprinkler Flows Using Particle Tracking and Laser-Induced Fluorescence," National Institute of Standards and Technology, Gaithersburg, MD, 2004.
- [21] A.D. Putorti, T.D. Belsinger, and W.H. Twilley, "Determination of Water Spray Drop Size and Speed from a Standard Orifice, Pendent Spray Sprinkler," National Institute of Standards and Technology, Gaithersburg, MD, FR4003 Sept. 1995, rev. May 1999.
- [22] J.F. Widmann, "Characterization of a Residential Fire Sprinkler Using Phase Doppler Interferometry," National Institute of Standards and Technology, Gaithersburg, MD, NISTIR 6561, 2000.
- [23] D. Madrzykowski and R.P. Fleming, "Residential Sprinkler Systems," in *Fire Protection Handbook 20th Edition*. Quincy, MA, United States of America: National Fire Protection Association, 2008, ch. 16, pp. 91-107.
- [24] D.C. Kincaid, K.H. Soloman, J. C. Oliphant, and A. W. Marshall, "Quantifying the Initial Spray from Fire Sprinklers," IAFSS, Karlsruhe, Deutschland, Fire Safety Science - Proceedings of the Ninth International Association of Fire Safety Science 2008.

# Appendix A





**Scope A Test Matrix**

Test No.	Solution	Ignition Source	Sprinkler Height (feet)	Sprinkler Pressure (psi)	Sprinkler (k-Factor)
A1	60% propylene glycol	6" wide heptane pan	8	10-80	Residential pendent fixed deflector (k3.1)
A2	60% propylene glycol	12" wide heptane pan	8	10-60	Residential pendent fixed deflector (k3.1)
A3	60% propylene glycol	spray burner assembly	8	10-60	Residential pendent fixed deflector (k3.1)
A4	50% propylene glycol	spray burner assembly	8	10-100	Residential pendent fixed deflector (k3.1)
A5	50% propylene glycol	12" wide heptane pan	8	10-120	Residential pendent fixed deflector (k3.1)
A6	50% propylene glycol	6" wide heptane pan	8	10-140	Residential pendent fixed deflector (k3.1)
A7	60% propylene glycol	electric range tops	8	10-150	Residential pendent fixed deflector (k3.1)
A8	60% propylene glycol	spray burner assembly	20	10-100	Residential pendent fixed deflector (k3.1)
A9	50% propylene glycol	spray burner assembly	20	10-150	Residential pendent fixed deflector (k3.1)
A10	50% propylene glycol	spray burner assembly	20	10-150	Residential pendent fixed deflector (k4.9)
A11	50% propylene glycol	spray burner assembly	8	10-150	Residential pendent fixed deflector (k4.9)
A12	50% propylene glycol	spray burner assembly	8	10-150	Residential pendent fixed deflector (k7.4)
A13	50% propylene glycol	spray burner assembly	20	10-150	Residential pendent fixed deflector (k7.4)
A14	50% propylene glycol	spray burner assembly	20	10-150	Residential pendent drop down deflector (k4.9)
A15	50% propylene glycol	spray burner assembly	8	10-150	Residential pendent drop down deflector (k4.9)
A16	50% glycerin	spray burner assembly	8	60-150	Residential pendent drop down deflector (k4.9)
A17	40% propylene glycol	spray burner assembly	8	60-150	Residential pendent drop down deflector (k4.9)
A18	water	spray burner assembly	8	10-150	Residential pendent drop down deflector (k4.9)
A19	50% propylene glycol	spray burner assembly	5	10-150	Residential sidewall sprinkler (k4.2)
A20	50% propylene glycol	spray burner assembly	5	10-150	Residential sidewall sprinkler (k5.5)
A21	50% propylene glycol	spray burner assembly	8	10-150	Residential sidewall sprinkler (k5.5)
A22	50% propylene glycol	spray burner assembly	8	10-150	Residential sidewall sprinkler (k4.2)
A23	40% propylene glycol	spray burner assembly	8	10-150	Residential pendent fixed deflector (k3.1)
A24	40% propylene glycol	spray burner assembly	8	10-150	Residential pendent fixed deflector (k4.9)
A25	40% propylene glycol	spray burner assembly	20	10-150	Residential pendent fixed deflector (k3.1)
A26	40% propylene glycol	spray burner assembly	8	10-150	Residential pendent fixed deflector (k4.9)
A27	50% glycerin	spray burner assembly	8	10-150	Residential pendent fixed deflector (k3.1)
A28	50% glycerin	spray burner assembly	20	10-150	Residential pendent fixed deflector (k3.1)
A29	50% glycerin	spray burner assembly	20	100	Residential pendent fixed deflector (k3.1)
A30	50% glycerin	spray burner assembly	8	10-150	Residential pendent fixed deflector (k4.9)
A31	50% glycerin	spray burner assembly	8	100	Residential pendent drop down deflector (k4.9)
A32	55% glycerin	spray burner assembly	8	10-150	Residential pendent drop down deflector (k4.9)
A33	45% propylene glycol	spray burner assembly	8	10-150	Residential pendent drop down deflector (k4.9)
A34	45% propylene glycol	spray burner assembly	20	120	Residential pendent fixed deflector (k3.1)
A35	50% glycerin heated to 140°F	spray burner assembly	8	10-150	Residential pendent drop down deflector (k4.9)



**Scope B Test Matrix**

Test No.	Solution	Fuel Package	Sprinkler Pressure/Flow Rate	Sprinkler (k-Factor)
B1	water	UL1626	18 gpm first sprinkler 13 gpm each for two sprinklers	Residential pendent fixed deflector (k3.1)
B2	water	UL1626	18 gpm first sprinkler 13 gpm each for two sprinklers	Residential pendent fixed deflector (k4.9)
B3	water	UL1626	80 psi	Residential pendent fixed deflector (k4.9)
B4	water	UL1626	80 psi	Residential pendent fixed deflector (k3.1)
B5	water	UL1626	150 psi	Residential pendent fixed deflector (k3.1)
B6	water	UL1626	150 psi	Residential pendent fixed deflector (k4.9)
B7	water	UL1626	150 psi	Residential sidewall sprinkler (k4.2)
B8	water	UL1626	80 psi	Residential sidewall sprinkler (k4.2)
B9	water	UL1626	24 gpm first sprinkler 17 gpm each for two sprinklers	Residential sidewall sprinkler (k4.2)
B10	40% propylene glycol	UL1626	18 gpm first sprinkler 13 gpm each for two sprinklers	Residential pendent fixed deflector (k4.9)
B11	50% glycerin	UL1626	18 gpm first sprinkler 13 gpm each for two sprinklers	Residential pendent fixed deflector (k4.9)
B12	50% glycerin	UL1626	18 gpm first sprinkler 13 gpm each for two sprinklers	Residential pendent fixed deflector (k3.1)
B13	50% glycerin	UL1626	150 psi	Residential pendent fixed deflector (k3.1)
B14	50% glycerin	Furnished living room	18 gpm first sprinkler 13 gpm each for two sprinklers	Residential pendent fixed deflector (k4.9)
B15	50% glycerin	UL1626	150 psi	Residential pendent fixed deflector (k4.9)
B16	50% glycerin	UL1626	80 psi	Residential pendent fixed deflector (k4.9)
B17	50% glycerin	UL1626	80 psi	Residential pendent fixed deflector (k3.1)
B18	50% glycerin	UL1626	24 gpm first sprinkler 17 gpm each for two sprinklers	Residential sidewall sprinkler (k4.2)
B19	50% glycerin	UL1626	80 psi	Residential sidewall sprinkler (k4.2)
B20	50% glycerin	UL1626	150 psi	Residential sidewall sprinkler (k4.2)